



Bulletin No.: PIT6376

Published date: 05/5/2025

Preliminary Information

PIT6376 Police Tahoe Aux Battery Disconnected DTC B1C6D

Models

Brand: Chevrolet Tahoe **Model:** Tahoe **Model Years:** 2025 **VIN:** All **Engine:** All **Transmissions:** All

from to

Involved Region or Country	North America
Additional Options (RPO)	K6K, 9C1, 5W4
Condition	Dealer may notice during PDI the aux battery is disconnected and DTC B1C6D SYM 12 and SYM 13 are set current in the BCM.
Cause	The assembly plant intentionally leaves the aux battery disconnected and during PDI process it should be connected.

Correction:

Vehicles with auxiliary battery in the rear cargo area will need the battery sensor attached to the battery and LIN connected to the battery sensor, Per the PDI sheet.

Note: Currently, there is an issues where DTC'S B1C6D SYM 12 and SYM 13 can not be cleared from the BCM. Engineering is reviewing the issues. Despite the DTC's being set current the Aux battery relay will function normally, with no warning light or messages.

Version History

Version	1
Modified	05/05/2025 - Created on.

 GM Global Brands

© 2025 General Motors. All Rights Reserved.