



**Bulletin No.:** PIT6380  
**Published date:** 05/12/2025

## Preliminary Information

### PIT6380 Side Mirror View Distorted

#### Models

**Brand:** Chevrolet **Model:** Equinox EV **Model Years:** 2024 - 2025 **VIN:** All **Engine:** All **Transmissions:** All

<b>Involved Region or Country:</b>	North America
<b>Additional RPO/s:</b>	S4X and PCH
<b>Condition:</b>	Customers may notice some distortion in one or both side mirror glass elements.
<b>Cause:</b>	If the vehicle was equipped with the accessory blackout mirror cap package (RPO S4X and PCH) it is possible the glass was not re-installed properly.

Dealers are to remove the mirror element and check on the back side for bent locator tabs.

Follow SI procedure doc ID: 6356261 for side glass element removal. If the locator tabs are found to be bent, please re-position them to the correct angle and re-install.

If the customer vehicle does not have the accessory blackout mirror cap package installed, proceed with normal diagnosis. Replace side mirror element only as necessary.



#### Version History

<b>Version</b>	1
<b>Modified</b>	Created 05/09/2025