

REFERENCE:	TSB: 05-001-25 GROUP: 05 - Brakes	Date:	May 17, 2025	REVISION:	-
VEHICLES AFFECTED:	2024 - 2025 (VF) RAM Promaster This bulletin applies to vehicles built on or before April 15, 2025 (MDH 0415XX) equipped with a 3.6L V6 24V VVT Engine (Sales Code ERF).			MARKET APPLICABILITY:	
				<input checked="" type="checkbox"/> NA	<input type="checkbox"/> MEA
				<input type="checkbox"/> SA	<input type="checkbox"/> IAP
				<input type="checkbox"/> EE	<input type="checkbox"/> CH
CUSTOMER SYMPTOM:	Customers may comment on one or more of the following:				
	<ul style="list-style-type: none"> • Brake pedal travel is longer than expected to stop the vehicle. • Have to really press on the brake pedal to get the vehicle to stop. 				
CAUSE:	Over torqued brake fluid reservoir cap				

REPAIR SUMMARY:

This bulletin involves bleeding the braking system and then properly installing the brake fluid reservoir cap.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
05-00-01-90	Bleed Brake System - Perform Brake Bleed Procedure (2 - Skilled)	5 - Brakes	0.5 Hrs.
Failure Codes	ZZ	Service Action	-

SPARE PARTS:

Qty	Part No.	Description	Notes
1	04549625AD	Fluid, Brake, Standard MS-9971	

DIAGNOSIS:

If the customer describes any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.

REPAIR PROCEDURE:

1. Remove the brake fluid reservoir cap.
2. Perform the brake bleed procedure. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info> 05 - Brakes / Standard Procedure / Brake Bleeding Procedure.
3. Install the brake fluid cap by turning it until you feel slight resistance, then gently tighten the cap to ensure it is secure.

CAUTION!

Ensure that the brake fluid reservoir cap is pointing out from the reservoir to prevent over tightening **Fig. 1**.

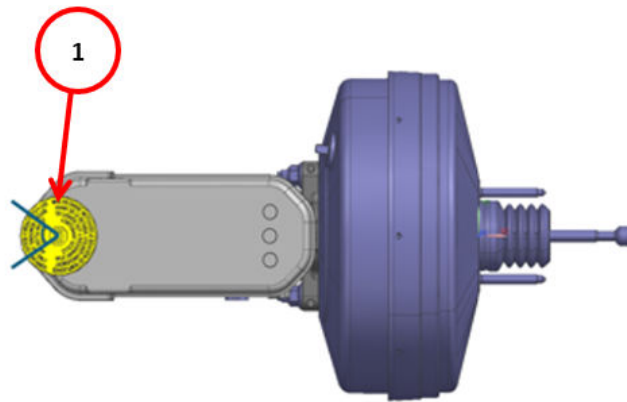


Fig. 1
Brake Fluid Reservoir Cap

1 - Correctly Orientated Brake Fluid Reservoir Cap

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.