



Service Bulletin

Bulletin No.: PIP6065

Date: May, 2025

PRELIMINARY INFORMATION

Subject: Service All Wheel Drive Message C1267

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	XT6	2025		ALL	ALL	ALL	ALL

Involved Region or Country	North America
Additional Options (RPO)	F48
Condition	Service All Wheel Drive Message with C1267. It is possible the concern cannot be duplicated by the dealer. C1267 may return after repairs have been made.
Cause	Possible chaffed wiring in the engine harness.

Correction

Place the vehicle in and out of All Wheel Drive (AWD).

An audible click should be heard from the AWD actuator and when on a hoist AWD engagement can be confirmed.

If it is confirmed that the actuator is engaging but C1267 continues to set intermittently inspect the wiring harness as described below.

Inspect the wiring harness between connector X112 and the M115 PTU Shift Actuator.



6932045

It may be found that some of the "Christmas tree" retainers are missing and the harness has been rubbing on the transmission case.

If this concern is found, repair the damaged circuits as necessary, and properly retain the harness so that future damage will be avoided.

If when shifting in and out of AWD the actuator does not engage follow SI diagnostics.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
* 5480778	Inspect harness for damage	0.3 Hrs.
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	05/16/2025 – Created on.