



PAC Module Camera Repair

Bulletin Type:	SRP	Publication Date:	May 2025
Bulletin #(s):	25-007	Make(s):	Jayco, Entegra Coach
Job Code(s):	<i>If affected unit has warranty remaining, submit your claim following the normal process</i>	Model(s):	Melbourne, Redhawk, Odyssey, Esteem, Greyhawk
Flat Rate(s):		Model Year(s):	2021 - 2026

Incident:	Radio screen displays "No Camera Input error".
Affected Units:	2021 - 2026 Jayco Melbourne, Redhawk, Greyhawk and 2021 - 2026 Entegra Coach Odyssey, Esteem
Parts List:	N/A
Misc. Tools & Supplies:	N/A

PAC MODULE CAMERA REPAIR INSTRUCTIONS

- Units use a 3-camera input, 1 camera output switcher module. It is made by PAC. It will be a black box with a PAC decal on it. (Figure 1)

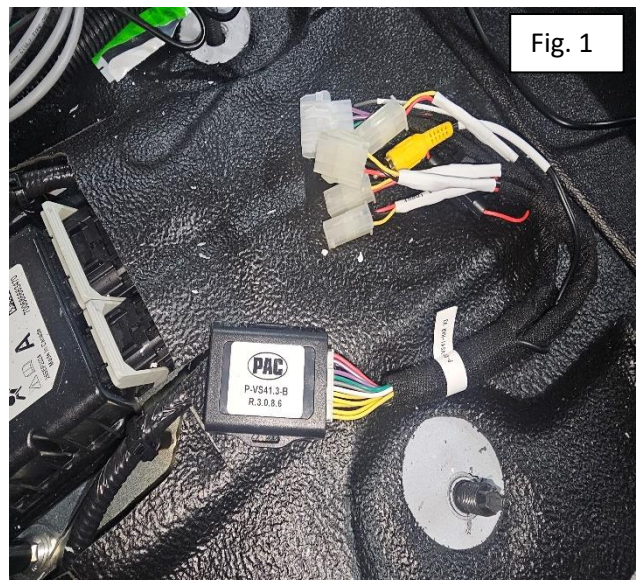


Fig. 1

2. PAC module will be tucked up under the dash in the steering column area. Find the inline fuse that is 3-4 inches from the PAC model in the wire harness.
3. The fuse is good if getting a no camera error only on 1 camera. It is either a loose connection on the wire harness at that camera or a bad camera. (Figures 2-5)



Fig. 2

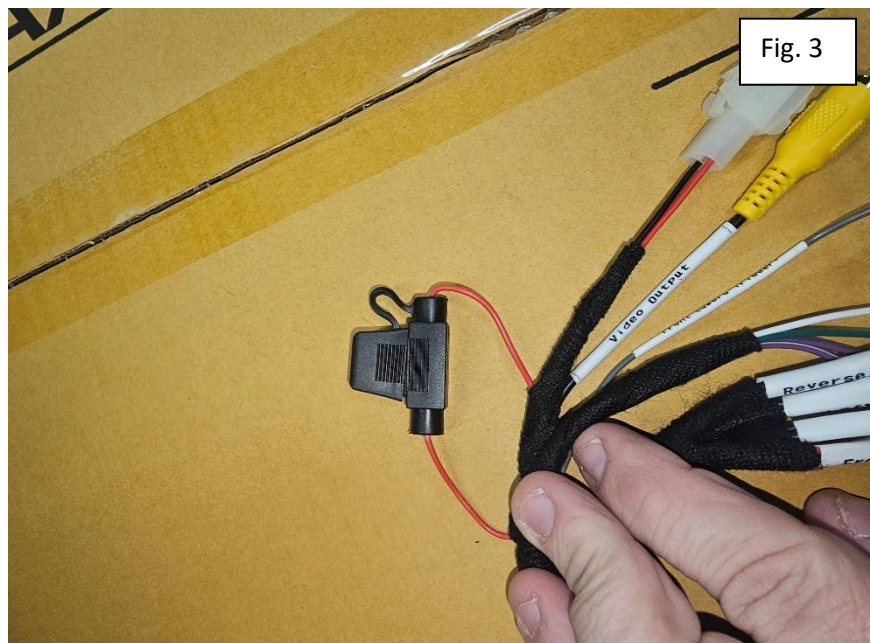


Fig. 3

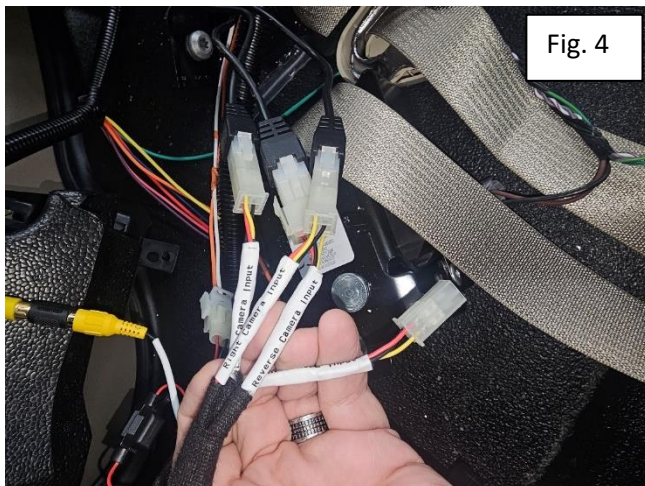


Fig. 4



Fig. 5

4. Camera inputs will kind of look like a CAT5 (network cable). They are marked left, right, and rear so it is pretty self-explanatory which is which.
5. That CAT5 connection carries the trigger signal and the video signal. The output of the PAC module is the single yellow RCA connection. (Figures 5-6)
6. The camera signal output will then plug into the wire harness on the back of the radio. (Figure 6)

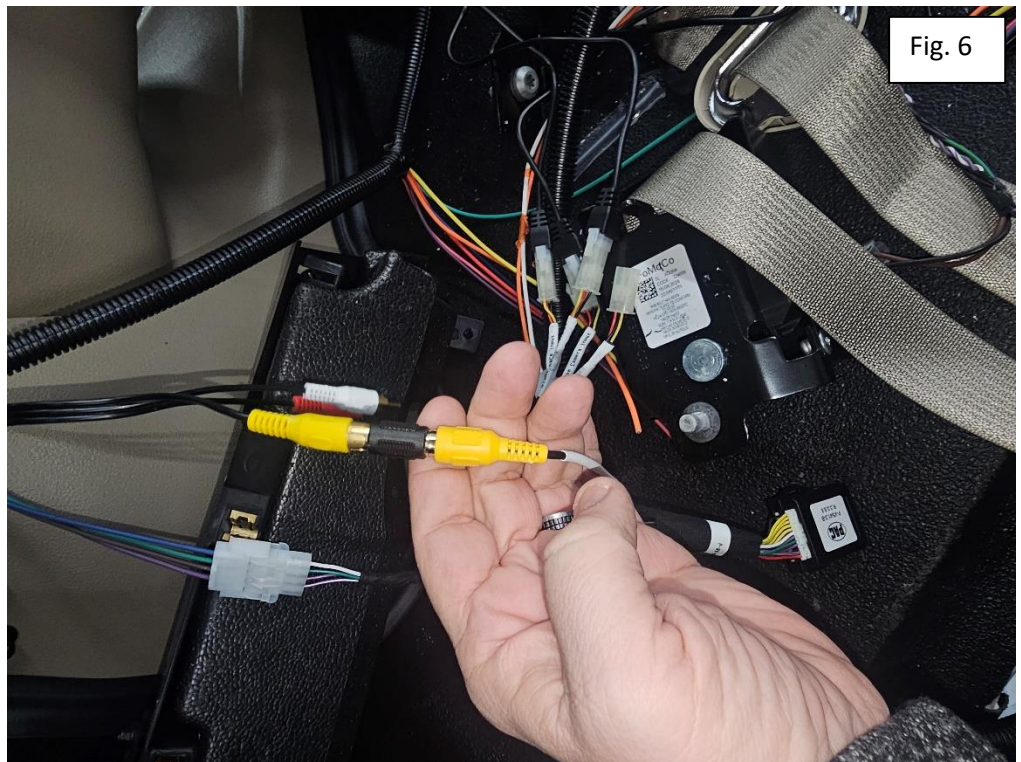


Fig. 6

7. All of the RCA inputs on the radio will plug into a harness that plugs into the big white harness input on the back of the radio. The GPS antenna we install will plug into the white square plug in the upper left marked GPS. The mic we install will plug into the red 3.5 mm MIC port.
8. The USB input for either charging or wired car play or Android auto plugs into the USB C cable that should come out of the top right of the radio AM/FM radio antenna plugs into the circular hole on the lower left. (Figure 7)



Fig. 7

9. Side view mirror with Camera on bottom left of it. (Figures 8-9).



Jayco's sole obligation under our limited warranty is to repair or replace defective materials and/or workmanship deemed our responsibility as determined by Jayco in our sole discretion. Jayco reserves the right to use new and/or remanufactured parts or materials of similar quality to complete any work, and to make parts and/or design changes as appropriate without notice to anyone. Jayco designs and/or materials changes are done without obligation to incorporate such changes in previously manufactured product. Jayco makes every reasonable effort to ensure field remedies will not adversely affect performance and/or safety of the unit. This field remedy is not intended to extend to future performance of this RV, or any of its materials, components or parts beyond the standard warranty period. The RV owner's obligation to notify Jayco, or one of its independent, authorized dealers, of a claimed defect does not modify any obligation placed on the RV owner to contact Jayco directly when attempting to pursue remedies under state or federal law.

903 South Main Street • P.O. Box 460 • Middlebury, IN 46540