



SSM 53814 2021-2024 Bronco - Water Leak From The A-Pillar, Overhead Console/Upfitter Switches And/Or Sun Visors

Some 2021-2024 Bronco vehicles may exhibit a water leak from the a-pillar, overhead console/upfitter switches and/or sun visors. If a leak is identified from this area, refer to Worskshop Manual (WSM), Section 501-18 Pinpoint Test (PPT) G for water leak diagnosis. If the PPT leads to the replacement of the header seal, a revised header seal has been released for service (M2DZ-7803110-H) which contains a thicker consistant bead of butyl across the entire length of the seal. The header seal will need to be firmly depressed and massaged to make sure all of the butyl that is across the entire header seal will properly adhere to the body, creating a water-tight seal. For claiming, use causal part 7803110 and applicable labor operations in Section 12 of the Service Labor Time Standards (SLTS) Manual. If labor times are not available, claim M-time.