

Search Request: Fuel Filler Flap Protrudes From Body Side or Does Not Open

Topic number	LI88.60-P-079003
Version	2
Function group	88.60 - Exterior flaps
Date	5/22/25
Validity	Model series 167 from production date 01.06.2024
Reason for change	

Complaint

- Fuel filler flap protrudes from side wall
- Fuel filler flap not opening

Cause

Under analysis

Remedy

Create TIPS case with the below information and send to the Body/Chassis/Entertainment Inbox:

Open the flap and take a detailed photo of the fuel tank strap attached at the hinge arm. Is the attachment bent or kinked? Are there pressure marks in the recess where the retaining strap is located when closed?

Check position of the fuel tank strap in the closed state - is it being pinched?

Check if the clipping is correct to see if the attachment surfaces are damaged. Removal of the recess to check the seal whether it is folded down.

Detach the fuel tank strap from the fuel filler neck at the hinge arm and place it in the recess, then close the flap again and check the protrusion. Is the protrusion better? Does the flap open with less force?

Disclaimer

NOTE: The information contained in this document is intended for use by trained, professional technicians with the knowledge to properly and safely perform diagnosis and repairs on Mercedes-Benz vehicles, using Mercedes-Benz approved tools and equipment. It informs service technicians about conditions that could occur in certain vehicles and provides information that could assist in proper vehicle diagnosis, service, or repair. It does not indicate that a defect is present in any vehicle referenced in this document nor does it imply warranty coverage. DO NOT assume that a symptom or condition, or a described cause of a symptom or condition, affects any particular vehicle or groups of vehicles, or that a described repair applies to any particular vehicle or groups of vehicles. There can be multiple causes resulting in the same or similar symptoms or conditions described in this document, and trained professional service

XENTRY Tips

technicians must use their diagnostic skills to make evaluations on a case-by-case basis. The information contained in this document does not guarantee warranty coverage nor does it extend the vehicle's warranty in any way.

Symptoms
Body > Door/Flap > Fuel filler flap > Inaccurate fit
Body > Door/Flap > Fuel filler flap > Jammed

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
	Tank filler recess	0.000 H	63126	
	Fuel filler flap cover	0.000 H	75101	
	Fuel filler flap central locking motor	0.000 H	82627	
		0.000 H	8850A	
		0.000 H	820HY	
		0.000 H	8840D	