

## GPOP - Issue Review System

**Part Number:** 68282133A\$, 68282135A\$

**Part Description:** BACKLITE (Heated Liftgate Glass Assembly)

**Issue Description:** For rear window defrost inoperative concerns where heated glass electrical tab has become detached, it is not necessary to replace the glass assembly. For loose or detached electrical tab, refer to TSB 23-007-25 for repair procedures on reattaching a loose tab. For burned or discolored gridlines on hard tops, DO NOT change the complete Flipper glass assembly. This discoloration is oxidation of the ceramic silver material and is normal. The Engineering standard call out the fact that this bus bar will change in color and is not a deterioration of the material or performance.