

## GPOP - Issue Review System

**Part Number:** 68525536A\$

**Part Description:** Receiver Module

---

**Issue Description:** DT25 TPMS Issues - TPMS not working, TPMS working intermittently, TPMS displaying wrong values, TPMS warnings on cluster In case of TPMS concerns, please follow the below:

- Perform TPMS Autolearn Procedure After Tire Rotation or Tire Change for Sensata TPM sensors. - Verify the sensor IDs are correct. If they are incorrect, autolearn the sensors. - If there are any issues in terms of tire pressure, inflate or deflate to the recommended pressure. - If DTCs - C15CB00 ("Front Axle Tire Pressure Placard Implausible") and/or C15CC00 ("Rear Axle Tire Pressure Placard Implausible") are being triggered, program the placard values. Also, check if the placard values were programmed previously. - If the sensors are loose, fix them to the wheel properly. - If there are aftermarket parts, any repairs will not be considered for warranty.