



Service Bulletin

Bulletin No.: PIP6064

Date: May, 2025

PRELIMINARY INFORMATION


Subject: LZ0 Multiple DTCs Due to Melted Harness

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado 1500	2025		All	All	LZ0	All
Chevrolet	Suburban	2025		All	All	LZ0	All
Chevrolet	Tahoe	2025		All	All	LZ0	All
GMC	Sierra 1500	2025		All	All	LZ0	All
GMC	Yukon	2025		All	All	LZ0	All
GMC	Yukon XL	2025		All	All	LZ0	All

Involved Region or Country	North America
Condition	MIL on with any of the following DTCs set in the ECM: B2AEF, P00EA, P00EB, P00EC, P01BB, P01BC, P01BD, P0202, P0203, P0204, P0206, P0264, P0265, P0267, P0268, P0270, P0271, P0276, P0277, P0335, P0403, P0405, P0406, P045A, P045C, P045D, P0489, P0490, P0651, P0685, P0686, P0690, P0960, P0962, P103B, P103C, P1249, P124A, P124B, P124D, P1682, P16A7, P16B3, P16BC, P16BD, P17F5, P17F6, P17F7, P17FA, P17FB, P17FC, P2053, P2147, P2148, P2150, P2151, P2153, P2154, P2156, P2157, P216B, P216C, P217B, P217C, P217E, P217F, P2381, P2382, P2384, P2564, P2565, U1608, U1609, U160C, U1610, U1611, U1615, U1617, U1639, U163D, U1643, U1647, U1659, U165A, U1818 and/or P0641.
Cause	This may be caused by a damaged wire harness that has come into contact with the EGR cooler outlet pipe or the duct bracket.

Correction

If you have any of the above DTCs, check the harness for damaged in the area indicated in the picture below. Repair as necessary and secure the harness to prevent repeat damage.

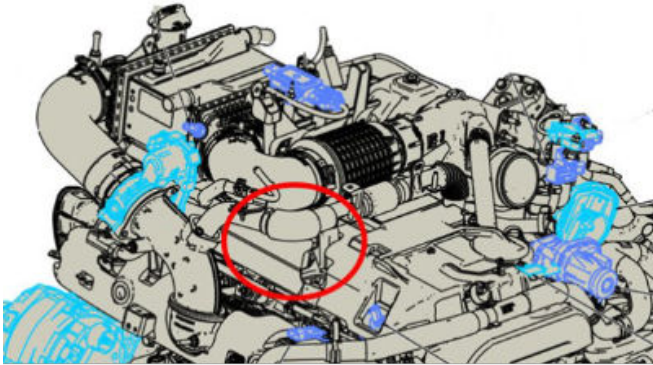

6927354

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
* 5480528	Locate electrical harness issue	0.3 hours
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	05/19/2025 – Created on.