

Load Compartment Cover Noises

Topic number	LI68.50-P-079347
Version	1
Function group	68.50 - Curtains, roller blinds, luggage net
Date	5/29/25
Validity	BR 254 before production date 09.12.2024
Reason for change	

Complaint

Load compartment cover generates a creaking noise during driving when pulled out to covering position.

Attachments	
File	Description
Beanstandung.MOV	

Cause

Aluminum cassette scrapes on the inside of the end cap. The contact point causes creaking noises.

Remedy

Disassemble end caps of load compartment cover by pressing the guide pins (see attachment) inwards and removing the end caps.

Cut 2 felt strips to required size of 25 mm/15 mm/1 mm (length/width/height).

Glue a piece of felt (see attachment) to each top corner in the direction of the roller blind outlet (left and right side).

Then reinstall the end caps with springs.

Attachments	
File	Description
Abhilfe 4.jpg	



[Abhilfe 3.jpg](#)



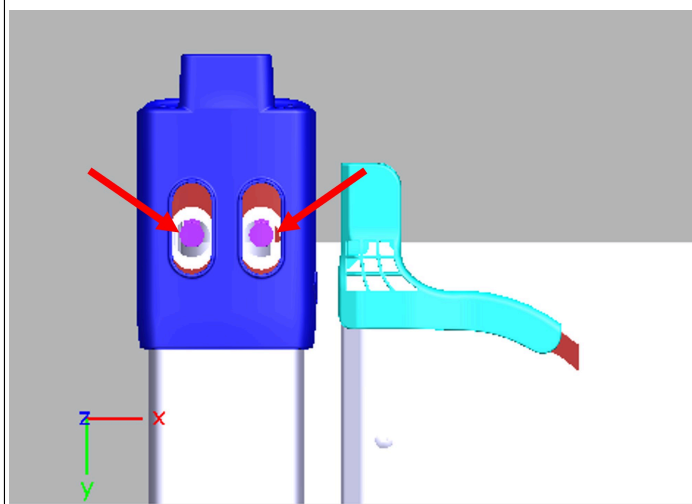
[Abhilfe 2.jpg](#)



[Abhilfe 1.jpg](#)



Pins.jpg



Guide pins for disassembling the end cap.

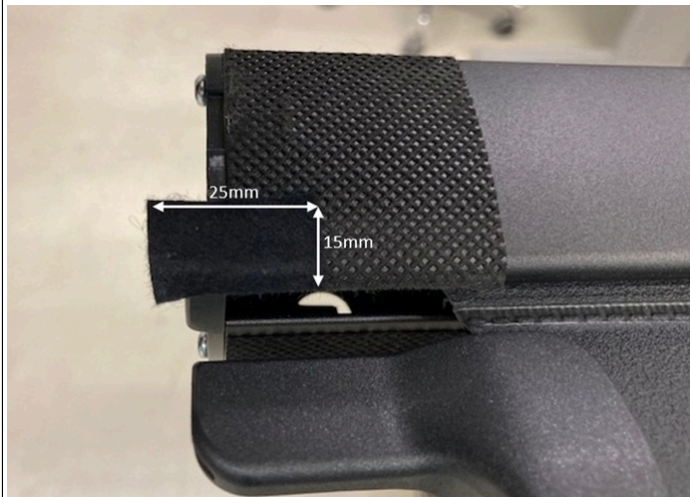
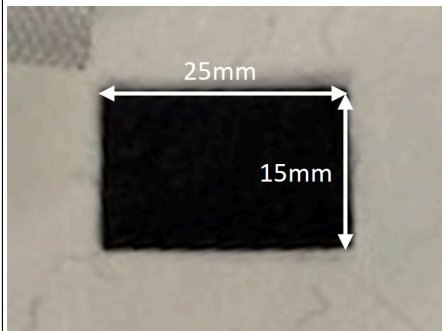
Disclaimer

NOTE: The information contained in this document is intended for use by trained, professional technicians with the knowledge to properly and safely perform diagnosis and repairs on Mercedes-Benz vehicles, using Mercedes-Benz approved tools and equipment. It informs service technicians about conditions that could occur in certain vehicles and provides information that could assist in proper vehicle diagnosis, service, or repair. It does not indicate that a defect is present in any vehicle referenced in this document nor does it imply warranty coverage. DO NOT assume that a symptom or condition, or a described cause of a symptom or condition, affects any particular vehicle or groups of ve-

hicles, or that a described repair applies to any particular vehicle or groups of vehicles. There can be multiple causes resulting in the same or similar symptoms or conditions described in this document, and trained professional service technicians must use their diagnostic skills to make evaluations on a case-by-case basis. The information contained in this document does not guarantee warranty coverage nor does it extend the vehicle's warranty in any way.

Symptoms
Body > Interior equipment > Cargo area cover/twin roller blind > Noise

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A0009837100			Felt strip	1	2 * 25 mm/15 mm/1 mm (L/W/H)	X

Attachments	
File	Description
Filz 1.jpg 	
Filz.jpg 	Felt 25 mm x 15 mm x 1 mm (L/W/H)

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			6909336	