



SSM 53859 2025 Expedition/Navigator - Illuminated ABS Warning Indicator With DTC U3012:68 Stored In The ABS Module

Some 2025 Expedition/Navigator vehicles may exhibit an illuminated anti-lock brake system (ABS) warning indicator with diagnostic trouble code (DTC) U3012:68 stored in the ABS module. The vehicle may also exhibit any of the following symptoms: a soft brake pedal following vehicle start-up, various brake system illuminated warning lamps and/or brake-related messages displayed in the instrument panel cluster (IPC). This may be due to a controller area network (CAN) communication concern within the ABS module. Replacement of the ABS module will not resolve this condition. If a U3012:68 is not present in the ABS module, this article does not apply. To resolve this condition, place the vehicle in park. Disengage the park brake. Turn the vehicle off. Close all doors and liftgate/tailgate. Allow the vehicle to sit for 5 minutes to allow all vehicle modules to power down. Restart the vehicle. Verify brake functionality and clear any DTCs. Pressing unlock/lock button on the key fob, opening the doors/liftgate/tailgate or keeping the key fob within 30 ft (8 meters) of the vehicle can prevent the modules from powering down completely. Inform customers that they can continue to drive the vehicle and engineering is currently working on a solution for this condition that is expected in Q3 2025. Monitor Professional Technician System (PTS) for additional information and schedule service appointments for customers once the repair becomes available.