



Service Bulletin

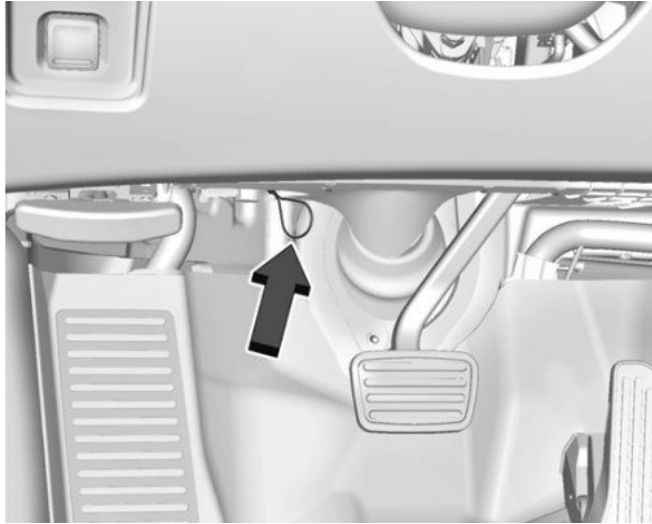
Bulletin No.: 25-NA-089

Date: April, 2025

INFORMATION

Subject: Information on Front Compartment Hood May Not Fully Unlatch When Release Button is Pressed and Gets Stuck in Secondary Latch Position and/or When Pulling Manual Release Cable Near Steering Column Does Not Release Hood Once it is in this Stuck Position

Brand:	Model:	Model Year:		VIN Breakpoint:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Corvette	2024	2025	—	—	—	—

Involved Region or Country	North America, Europe, Middle East, Israel, Palestine, Japan, Philippines, Australia/New Zealand
Condition	<p>Some customers may comment on having one or more of the following conditions.</p> <ul style="list-style-type: none"> • The front compartment hood may not fully unlatch when the release button is pressed and gets stuck in the secondary latch position. • Pulling the manual release cable near the steering column does not release the hood once it is in this stuck position.
Cause	<p>The condition may be caused by the 12V battery being too weak to start the engine, yet it may still be strong enough to electrically release the front compartment lid when commanded. The front compartment lid may release from the primary release latch, but it is possible that it may become stuck on the secondary latch. The secondary latch release requires more power than what is available from the vehicle's 12V battery in that moment.</p> <p>Note: This is a common condition when trying to access the compartment to charge a weak 12V battery.</p>
Correction	 <p>If the situation described above is encountered, dealership technicians are to first press down and manually close the front compartment lid all the way. Next, firmly pull the</p>

6880615

manual release cable twice to open the front compartment lid that is located at the base of the steering column, as shown in the picture above.

Note: The cable does require a fair amount of effort to pull. If a hook tool is available, it may work much easier than using just a finger.

Important: For the manual release cable to work properly, the front compartment lid must be fully closed on the primary latch.

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Version	1
Modified	Released April 07, 2025

