

<b>REFERENCE:</b>	<b>TSB:</b> 08-180-25 <b>GROUP:</b> 08 - Electrical	<b>Date:</b>	June 4, 2025	<b>REVISION:</b>	—
<b>VEHICLES AFFECTED:</b>	<b>2024 (KM) Jeep Wagoneer S</b> This bulletin applies to vehicles built on or after November 27, 2024 (MDH 1127XX) and on or before November 29, 2024 (MDH 1129XX) equipped with a 400V G2500 FR/RR Elec Drive Motors (Sales Code ELD), Power Seat Back Massage - FRT Pass (Sales Code CE5) and Power Seat Back Massage - Driver (Sales Code CE9).	<b>MARKET APPLICABILITY:</b>			
		<input checked="" type="checkbox"/> NA <input type="checkbox"/> MEA <input type="checkbox"/> SA <input type="checkbox"/> IAP <input type="checkbox"/> EE <input type="checkbox"/> CH			
<b>CUSTOMER SYMPTOM:</b>	<p>The vehicle must exhibit/set the following Diagnostic Trouble Code (DTC):</p> <ul style="list-style-type: none"> <li>B1D60-00 - Front Seat Identification Circuit.</li> </ul> <p><b>NOTE:</b> There is no Malfunction Indicator Lamp (MIL) illumination accompanying this DTC.</p> <p>Customers may also comment on the following:</p> <ul style="list-style-type: none"> <li>The seat massage lumbar and bolsters are inoperable.</li> </ul>				
<b>CAUSE:</b>	Manufacturing issue				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 25-104, date of issue June 04, 2025. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

**REPAIR SUMMARY:**

This bulletin involves performing a Seat Massage Module Driver (SMMD) and Seat Massage Module Passenger (SMMP) self-tests.

**CLAIMS DATA:**

Labor Operation No:	Labor Description	Skill Category	Labor Time
18-19-29-93	Modules, Seat Massage Driver (SMMD) and Passenger (SMMP) - Perform Self-Test Routine (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs.
Failure Code	ZY	Service Action	

**SPECIAL TOOLS/EQUIPMENT:**

Description	Ref. No.	Notes
wiTECH or Equivalent	-	-


## DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/ Service Library, verify all related systems are functioning as designed. If DTC or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptom listed above in the customer symptom section, perform the Repair Procedure.

## REPAIR PROCEDURE:

1. Using wiTECH, perform the Seat Massage Module Driver (SMMD) and Seat Massage Module Passenger (SMMP) self-test [Fig. 1](#).

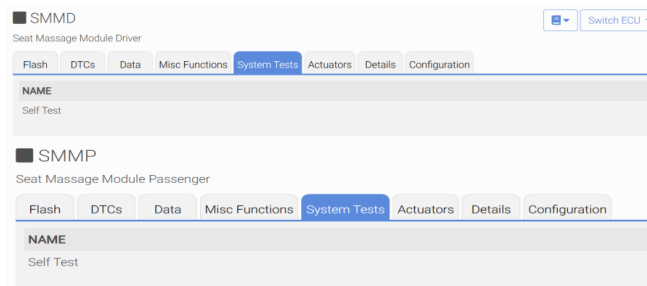

**Fig. 1**  
wiTECH Self-Test Screens

2. Clear all DTCs that may have been set.
3. Perform an "On" then "Off" ignition cycle to ensure **DTC B1D60-00** is no longer active.

## POLICY:

Reimbursable within the provisions of the warranty.

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*