

Technical Service Bulletin (TSB)
Hard To Fill With Fuel

REFERENCE:	TSB: 14-013-25 GROUP: 14 - Fuel	Date:	June 4, 2025	REVISION:	–
VEHICLES AFFECTED:	2019 - 2020 (DS) RAM 1500 Pickup 2019 - 2020 (DT) RAM 1500 Pickup This bulletin applies to vehicles built on or after August 01, 2019 (MDH 0801XX) equipped with: • 23 Gallon Fuel Tank (Sales Code NF5). • 26 Gallon Fuel Tank (Sales Code NFW). • 33 Gallon Fuel Tank (Sales Code NFF).			MARKET APPLICABILITY: ☒ NA☐ MEA ☐ SA☐ IAP ☐ EE☐ CH	
CUSTOMER SYMPTOM:	Customers may experience one or more of the following: • Hard, difficult, or unable to fill the fuel tank. • Fuel nozzle shuts off prematurely before the fuel tank is full.				
CAUSE:	Vent Line Issue				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 25-103, date of issue June 04, 2025.

REPAIR SUMMARY:

This bulletin involves replacing the fuel tank.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
14-60-01-9P	Fuel Tank - Replace DT Models (1 - Semi-Skilled)	1 - Engine Repair and Performance	1.3 Hrs.
14-60-01-9Q	Fuel Tank - Replace DS Models (1 - Semi-Skilled)	1 - Engine Repair and Performance	1.4 Hrs.
Failure Code	ZZ	Service Action	

RELATED LOP:

Labor Operation No:	Labor Description	Skill Category	Labor Time
14-60-01-66	Drain Fuel w/ 23 or 26 Gallon Tank (0 - Introduction)	14 - Fuel System	0.3 Hrs.
14-60-01-67	Drain Fuel w/ 32 or 33 Gallon Tank (0 - Introduction)	14 - Fuel System	0.4 Hrs.
14-60-01-61	Skid plate equipped, 33 Gallon Tank (0 - Introduction)	14 - Fuel System	0.3 Hrs.
14-60-01-64	Skid plate equipped (0 - Introduction)	14 - Fuel System	0.2 Hrs.

SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	68518028AB	Tank, Fuel	DS Models Sales Code NFW
1 (AR)	68408875AF	Tank, Fuel	DT Models Sales Code NFF
1 (AR)	68584761AA	Tank, Fuel	DT Models Sales Code NFW
1 (AR)	68584756AA	Tank, Fuel	DT Models Sales Code NF5
1 (AR)	68304753AA	O Ring, Fuel Pump and Level Unit	Rubber O-ring
1 (AR)	04721916AA	Ring, Lock, Fuel Module	

DIAGNOSIS:

If the customer describes any of the symptom listed above in the customer symptom section, perform the Repair Procedure.

REPAIR PROCEDURE:

NOTE: This is not a proactive repair. This Repair Procedure is to only be performed under this RSU if the vehicle exhibits the symptoms/conditions listed in this document and is still under warranty.

1. Perform Hard To Fill With Fuel diagnostics. Refer to the detailed service procedures available in DealerCONNECT / Service Library under: Service Info> 14 - Fuel System / Fuel Delivery, Gas / Diagnosis and Testing / Hard To Fill With Fuel.
2. If the issue is determined to be in the fuel tank, it must be replaced. Refer to the detailed service procedures available in DealerCONNECT / Service Library under: Service Info> 14 - Fuel System / Fuel Delivery, Gas / Tank, Fuel / Removal.

3. Remove all vent lines from the tank assembly.
4. Remove the vapor canister. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info>25 - Emissions Control / Evaporative Emissions / Canister, Vapor / Removal.
5. Remove the fuel pump module. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info> 14 - Fuel System / Fuel Delivery, Gas / Module, Fuel Pump / Removal.
6. Install the fuel pump module. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info> 14 - Fuel System / Fuel Delivery, Gas / Module, Fuel Pump / Installation.
7. Install the vapor canister. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info> 25 - Emissions Control / Evaporative Emissions / Canister, Vapor / Installation.
8. Install all vent lines on the tank assembly.
9. Install the fuel tank. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info> 14 - Fuel System / Fuel Delivery, Gas / Tank, Fuel / Installation.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.