



Service Bulletin

Bulletin No.: 25-NA-095

Date: April, 2025

INFORMATION

Subject: Information on Malfunction Indicator Lamp (MIL) Illuminated - Multiple Circuit DTCs Set

Brand:	Model:	Model Year:		Build Date:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Models	2024	2025			LM2, LZ0	
Chevrolet	Silverado 1500	2024	2025				
	Suburban	2024	2025				
	Tahoe						
GMC	Sierra 1500	2024	2025				
	Yukon Models	2024	2025				

Involved Region or Country	North America
Condition	<p>Some customers may comment on the MIL is illuminated. Some technicians may comment on one or more DTC set in the Engine Control Module (ECM):</p> <ul style="list-style-type: none"> • P0201 Cylinder 1 Fuel Injector Control Circuit • P0202 Cylinder 2 Fuel Injector Control Circuit • P0203 Cylinder 3 Fuel Injector Control Circuit • P0204 Cylinder 4 Fuel Injector Control Circuit • P0205 Cylinder 5 Fuel Injector Control Circuit • P0206 Cylinder 6 Fuel Injector Control Circuit
Cause	This condition may be caused by a faulty connection at the high-pressure diesel fuel injector.
Correction	Engineering has found that these codes can set as a result of one of the terminals in the fuel injector wire harness being bad. Even though the terminals in the harness pass the drag test with the connector installed, the issue is likely a terminal with low tension.



6890605

Inspect the fuel injector wire harness build date:

- The date code is underlined in red (DD/MM/YEAR).
 - In the example above, the date on this tag is January 17, 2023. This date is when the wire harness was built.
- ⇒ For vehicles with a build date in November or December of 2023, June or July of 2024, OR May of 2024, it may be required to replace the high-pressure diesel fuel injector indicated by the code set and fuel injector wire harness.

For vehicles with a fuel injector wire harness built outside of the dates above, test the high pressure diesel fuel injector for continuity:

- If the fuel injector has continuity and there is no evidence that the terminals on the high-pressure diesel fuel injector are damaged, replace the fuel injector wire harness.
- If the terminals on the high pressure diesel fuel injector are damaged, replace the high-pressure diesel fuel injector and the fuel injector wire harness.

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Version	1
Modified	Released April 15, 2025