



SSM 53875 2025 Bronco/Ranger - Various Brake System Warning Lamps/Fault Messages - DTCs C003A, C0037, C2005, And/Or C2006 Stored In The ABS Module

Some 2025 Bronco and Ranger vehicles may exhibit various illuminated brake system warning lamps/fault messages at start up with diagnostic trouble codes (DTCs) C003A:4A, C003A:64, C0037:4A, C0037:64, C2005:1D, C2005:78, C2006:1D, and/or C2006:78 stored in the antilock brake system (ABS) module. To correct this condition, clear the DTCs, turn the ignition off and then back on, engage and disengage the park brake and then run a self-test. If any DTCs return, refer to the Workshop Manual (WSM) for normal diagnosis. If the DTCs clear, this concern may be due to the ABS software and replacement of the ABS module or wheel speed sensors will not resolve this condition. Inform the customers they can continue to drive the vehicle and engineering is currently working on a solution for this condition that is expected in Q3 of 2025. Monitor Professional Technician System (PTS) for additional information and schedule service appointments for customers once the repair becomes available.