

**Technical Service Bulletin (TSB)**  
**R1H Radio Over The Air Update U29.42**  
**And U33.43 To U35.18 Software Version**

<b>REFERENCE:</b>	<b>TSB:</b> 08-125-25 REV. A <b>GROUP:</b> 08 - Electrical	<b>Date:</b>	June 13, 2025	<b>REVISION:</b>	08-125-25
<b>VEHICLES AFFECTED:</b>	<b>2025 (WS) Jeep Wagoneer / Grand Wagoneer</b> <b>This bulletin applies to vehicles built on or before April 21, 2025 (MDH 0421XX) equipped with a Global Telematics Box Module (Sales Code RDG) and one of the following radios:</b> <ul style="list-style-type: none"> <li>Uconnect 5 NAV W 10.1" Display (Sales Codes UBN or UEN).</li> <li>Uconnect 5 NAV W 12" Display (Sales Codes UBQ or UEQ).</li> </ul>			<b>MARKET APPLICABILITY:</b> <input checked="" type="checkbox"/> NA <input type="checkbox"/> MEA <input type="checkbox"/> SA <input type="checkbox"/> IAP <input type="checkbox"/> EE <input type="checkbox"/> CH <b>NOTE: **This bulletin applies to the North American market.**</b>	
<b>CUSTOMER SYMPTOM:</b>	<b>Customers may experience one or more of the following:</b> <ul style="list-style-type: none"> <li>Unable to select the Turn by Turn Navigation.</li> <li>Blank performance pages (<b>Rearview Camera (RVC) functions normally</b>).</li> <li>Android Auto® Voice Recognition (VR) inoperative.</li> <li>Media Tuner delayed.</li> <li>Charge Schedule not accepting updates via phone (<b>RVC functions normally</b>).</li> <li>Ambient light inoperative.</li> <li>Map in Instrument Panel Cluster (IPC) inoperative.</li> <li>Media Widget blank.</li> <li>Navigation Map black.</li> <li>Off-Road Pages inoperative (<b>RVC functions normally</b>).</li> <li>VR inoperative.</li> <li>Incorrect song title displayed (<b>Carplay® only</b>).</li> <li>Radio display switches from Media Page to Home Page (<b>RVC functions normally</b>).</li> <li>Ghost touch on Navigation screen (<b>RVC functions normally</b>).</li> <li>Widgets missing.</li> <li>New User Profile does not load.</li> <li>Returns to wrong page after View Camera Event selected by customer in the Camera View Pages (<b>RVC functions normally</b>).</li> </ul>				
<b>CAUSE:</b>	Software improvements				

**This bulletin supersedes Technical Service Bulletin (TSB) 08-125-25, date of issue April 25, 2025, which should be removed from your files. All revisions are highlighted with **\*\*asterisks\*\*** and include an updated software version and additional Market Note.**

**REPAIR SUMMARY:**

This bulletin provides information regarding the latest FOTA update and provides the service technician an overview of the steps a customer will need to take to complete the update. The radio software will be updated from **\*\*U29.42 and U33.43 to U35.18.\*\***


**NOTE: The national launch for the FOTA is expected to begin April 18, 2025.**

**DISCUSSION:**

Vehicles sold in North America can now receive software updates “over-the-air”. Updates to software will occur in a phased roll-out. The software is updated through a builtin cellular modem in the vehicle. Customers will see a notification on their radio screen when new software is available for their radio [Fig. 1](#). The owner will have the option to update the radio or schedule the update for later. There is not an option to decline the update indefinitely, the update must be performed.

**NOTE: This is an Information Only TSB to inform the dealer how the FOTA update is performed. This document does not contain a LOP for reimbursement.**


1. The vehicle needs to be in ‘Park’ and the ignition in the off position.
2. If the customer selects “Update Now” they can shut off the vehicle and leave. The update will be completed automatically [Fig. 1](#).

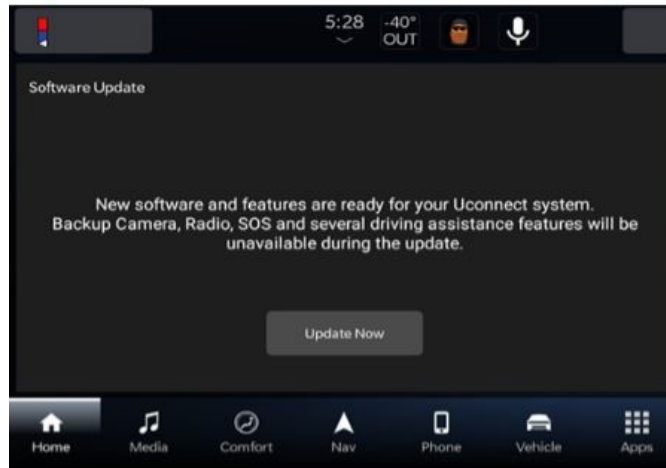

**Fig. 1**  
Software Update Screen

**NOTE: This step may take several minutes to complete.**

3. Upon completion of update, the radio will display a confirmation message [Fig. 2](#).

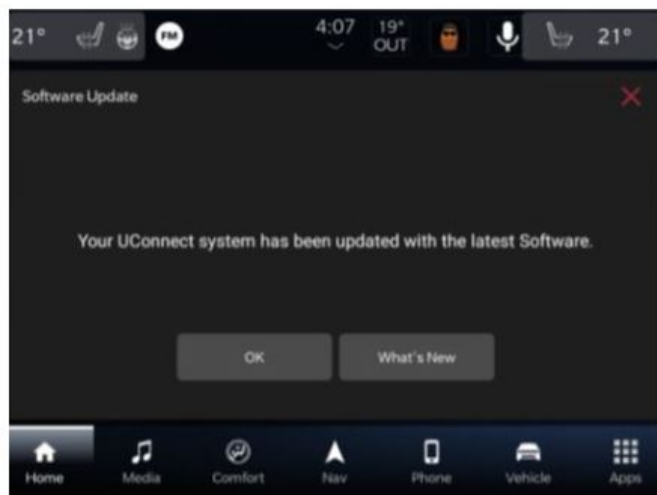

**Fig. 2**  
Software Update Confirmation Screen

**POLICY:**

Information Only

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*