



SSM 53961 2025 Ranger - Turn Signal Fast Flash On IPC

Some 2025 Ranger vehicles may exhibit a turn signal fast flash on the instrument panel cluster (IPC) while outside turn signals operate properly. This may be due to a loose connection in connector C222. To correct this concern, inspect inline connector C222 located behind the right side of the instrument panel for correct pin fit at pin 58 (YE-GN). Refer to the Workshop Manual (WSM), Section 417-01 and repair as necessary. For claiming, use causal part 14290 and labor operations 12651D, 12651D45 and 12651D45WR in Section 10 of the Service Labor Time Standards (SLTS) Manual.