



Service Bulletin

Bulletin No.: 25-NA-096

Date: April, 2025

TECHNICAL

Subject: Service Electronic Steering Column Lock

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade	2025	2025	-	—	All	All
	Escalade ESV	2025	2025				
	Escalade IQ	2025	2025				
Chevrolet	Suburban	2025	2025				
	Tahoe	2025	2025				
GMC	Yukon	2025	2025				
	Yukon XL	2025	2025				

Involved Region or Country	Mexico, Europe, Kazakhstan, Uzbekistan, Middle East
Condition	Some customers may comment on that they have a "Service Steering Column Lock" message or are unable to move the steering wheel after starting the vehicle. A technician may also find a U03000.49 set as current.
Cause	The cause of the condition may be a software anomaly in the K60 Column Lock Module.
Correction	Confirm DTC U03000.49 is current. Program the K60 Column Lock Module with the latest software in Techline Connect. Clear all DTC's and confirm the message/condition and DTC have not returned.

Service Procedure

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Important: This technical service bulletin (TSB) can only be completed by certified repair facilities who have met all specific training, tool, and equipment requirements pertaining to the vehicle Brand and Model serviced. Repairs must be performed by a technician who has successfully completed the required training.

Caution: Before downloading the update files, be sure the computer is connected to the internet through a network cable (hardwired). DO NOT DOWNLOAD or install the files wirelessly. If there is an interruption during programming, programming failure or control module damage may occur.

- Ensure the programming tool is equipped with the latest software and is securely connected to the data link connector. If there is an interruption during programming, programming failure or control module damage may occur.
- Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will interrupt programming. Install a GM Authorized Programming Support Tool to maintain system voltage. Refer to www.gmdesolutions.com for further information. If not available, connect a fully charged 12 V jumper or booster pack disconnected from the AC voltage supply. DO NOT connect a battery charger.
- Follow the on-screen prompts regarding ignition power mode but ensure that anything that drains excessive power (exterior lights, HVAC blower motor, etc) is off.

- Please verify that the radio time and date are set correctly before inserting USB drive into vehicle for programming; otherwise, an error will result.
- Clear DTCs after programming is complete. Clearing powertrain DTCs will set the Inspection/Maintenance (I/M) system status indicators to NO.

Important: The service technician always needs to verify that the VIN displayed in the TLC left side drop down menu and the top center window match the VIN plate of the vehicle to be programmed prior to using Service Programming System 2 (SPS2) for programming or reprogramming a module.

- For the TLC application, service technicians need to always ensure that the power mode (ignition) is “ON” before reading the VIN from the vehicle’s VIN master module and that they do not select a VIN that is already in the TLC application memory from a previous vehicle.
- If the VIN that shows up in the TLC top center window after correctly reading the VIN from the vehicle does not match the VIN plate of the vehicle, manually type in the VIN characters from the vehicle VIN plate into the TLC top center window and use these for programming or reprogramming the subject module with the correct vehicle VIN and software and/or calibrations.
- The Engine Control Module (ECM) is the master module (for VIP vehicles) that TLC reads to determine the VIN of the vehicle. If the VIN read from the vehicle by TLC does not match the VIN plate of the vehicle, the ECM also needs to be reprogrammed with the correct VIN, software and calibrations that match the vehicle’s VIN plate.
- The Body Control Module (BCM) is the master module (for GEM vehicles) that TLC reads to determine the VIN of the vehicle. If the VIN read from the vehicle by TLC does not match the VIN plate of the vehicle, the BCM also needs to be reprogrammed with the correct VIN, software and calibrations that match the vehicle’s VIN plate.

Caution: Be sure the VIN selected in the drop-down menu (1) is the same as the vehicle connected (2) before beginning programming.

The screenshot displays the Techline Connect SPS2 interface. At the top, the GM logo and 'Techline Connect Version: 1.8.0.2 Production' are visible. A navigation bar includes 'DASHBOARD', 'GDS2', 'SI', and 'SPS2' buttons, along with 'Support', 'RPO', and 'Search Service Manuals' options. The main content area is titled 'Welcome to Service Programming System 2'. On the left, a VIN selection dropdown menu is highlighted with a circled '1'. The selected VIN is '1GNSKGR...', and the vehicle details below it are: Model: Suburban - 4WD, Type: -, Make: Chevrolet, Year: 2021, and Job Card: [empty]. On the right, the 'Diagnostic Tool Ready!' status is shown as 'J2534', and the 'Selected Programming Process' is set to 'Reprogram'. At the top right, a 'Connect Vehicle' button is highlighted with a circled '2', and the connected vehicle information is displayed as '2021 • Chevrolet • Suburban - 4WD'. At the bottom left, there are 'Print' and 'Settings' buttons. At the bottom right, there are 'Auto Detect New Vehicle', 'Manually Enter Vehicle', 'Auto Detect Tool', and 'Manual' buttons. System information at the bottom left shows: Java Version: 1.8.0_92, SPS2 Version: 2.8.5.5060, and Windows Version: Windows 10.

Important: If the vehicle VIN DOES NOT match, the message below will be shown



5877000



5644477

Important: Techline Connect screens shown above.

Important: If the same calibration/software warning is noted on the TLC Summary screen, select OK and follow screen instructions. After a successful programming event, the WCC is located in the Service Programming System dialogue box of the SPS Summary screen. No further action is required. Refer to the Warranty section of the bulletin.

1. Reprogram the K60 Column Lock module. Refer to *K60 Column Lock Module: Programming and Setup* in SI.



5644478

Note: The screenshot above is an example of module programming and may not be indicative of the specific module that is being programmed. Module selection and VIN information have been blacked out.

Important: To avoid warranty transaction rejections, you MUST record the warranty claim code provided on the Warranty Claim Code (WCC) screen shown above on the job card. Refer to callout 1 above for the location of the WCC on the screen.

- Record SPS Warranty Claim Code on job card for warranty transaction submission.

Parts Information

No parts are required for this repair.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2080878*	Column Lock Module Programming U3000.49	0.3 Hr.

*This is a unique Labor Operation for Bulletin use only.

Important: **To avoid warranty transaction rejections, carefully read and follow the instructions below:

Labor Operation	Description	Labor Time
<p>Labour Time [Top]</p> <p>Labour Operation Code:</p> <p>Additional labour op code information: <input type="text"/> SPS Warranty Claim Code: <input type="text"/></p>		
<p>6125814</p>		
<ul style="list-style-type: none">• The Warranty Claim Code must be accurately entered in the “Warranty Claim Code” field of the transaction.• When more than one Warranty Claim Code is generated for a programming event, it is required to document all Warranty Claim Codes in the “Correction” field on the job card. Dealers must also enter one of the codes in the “Warranty Claim Code” field of the transaction, otherwise the transaction will reject. It is best practice to enter the FINAL code provided by SPS2.		

Warranty Claim Code Information Retrieval

VIN	Module	Function	Warranty Claim Code	Job Card
[REDACTED]	K73 - Telematics Communication Interface Control Module	Programming & Service Activation	[REDACTED]	test
[REDACTED]	K9 - Body Control Module	Programming	[REDACTED]	test
[REDACTED]	K5 - Automatic Level Control Module Ignition	Off	[REDACTED]	test driver
[REDACTED]	K56 - Serial Data Gateway Module	Programming	[REDACTED]	test driver

If the Warranty Claim Code was not recorded on the Job Card, the code can be retrieved in the SPS2 system as follows:

1. Open TLC on the computer used to program the vehicle.
2. Select and start SPS2.
3. Select Settings (1).
4. Select the Warranty Claim Code tab (2).

The VIN, Warranty Claim Code and Date/Time will be listed on a roster of recent programming events. If the code is retrievable, dealers should resubmit the transaction making sure to include the code in the SPS Warranty Claim Code field.

Version	1
Modified	Released April 16, 2025

ADDITIONAL SI KEYWORDS: U3000

