



GROUP	MODEL
ELE	2024-2025MY Seltos (SP2) w/ 1.6L T-GDI GAMMA
NUMBER	DATE
359	June 2025

## TECHNICAL SERVICE BULLETIN

### SUBJECT: SERVICE ACTION: OIL CHANGE REMINDER RESET OPERATION LOGIC (SA592)

This bulletin provides information to upgrade the Integrated Control Unit 'ICU' software on certain 2024-2025MY Seltos (SP2) vehicles equipped with 1.6L T-GDI GAMMA engines produced from February 14, 2023 through June 29, 2024. The affected vehicles are not equipped with the Oil Change Reminder Reset selection on the Audio Video Navigation 'AVN' screen. Some of the affected vehicles may require the 'AVN' software to be updated after the 'ICU' software upgrade is completed to enable the feature. Follow the procedure outlined in this publication to perform the 'ICU', and if necessary, 'AVN' head unit software upgrade on the applicable vehicle. Refer to [SST081](#) for software upgrade instructions using Kia Diagnostic System 'KDS' tablet and VCI-II and confirm the Upgrade Event Number/Name, ROM ID Information, and Manual Mode passwords (if applicable) on the applicable vehicle.



#### NOTICE

**A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.**

Repair status for a VIN is provided on KDealer+ (Service → Warranty Coverage → Warranty Coverage Inquiry → Campaign Information). Not completed Recall / Service Action reports are available on KDealer+ (Consumer Affairs → Not Completed Recall → Recall VIN → Select Report), which includes a list of affected vehicles.

This issue number is SA592.

## Refer to [TSB SST081](#) for instructions to upgrade the 'ICU' system:

To correct this condition, the ICU should be reprogrammed using the KDS download, as described in this bulletin.

### Upgrade Event Name

757.SP2 PE ICU Upgrade for Oil Change Reminder Reset Operation Logic


### NOTICE

- Confirm a fully charged battery (12.3 volts or higher is necessary) is used or utilize a fully charged jump starter box connected to the battery.
- **Ensure the KDS GDS is sufficiently charged at 60% or higher prior to reflash.**
- All ECU upgrades must be performed with the ignition set to the 'ON' position unless otherwise stated.
- **Damaged VCI II units should not be used and promptly replaced.**
- Be careful not to disconnect the VCI-II connected to the vehicle during the ECU upgrade procedure.
- **DO NOT start the engine during ECU upgrade.**
- DO NOT turn the ignition key 'OFF' or interrupt the power supply during ECU upgrade.
- **When the ECU upgrade is completed, turn the ignition 'OFF' and wait 10 seconds before starting the engine.**
- ONLY use approved ECU upgrade software designated for the correct application.

### IMPORTANT

It is recommended to ALWAYS check the Electronic Parts Catalog (EPC) to locate the ECU Part Number respective to Auto/Manual Mode ROM IDs. DO NOT reference the parts label affixed to the ECU.

[Connect the negative \(-\) terminal to the battery as shown below.](#)

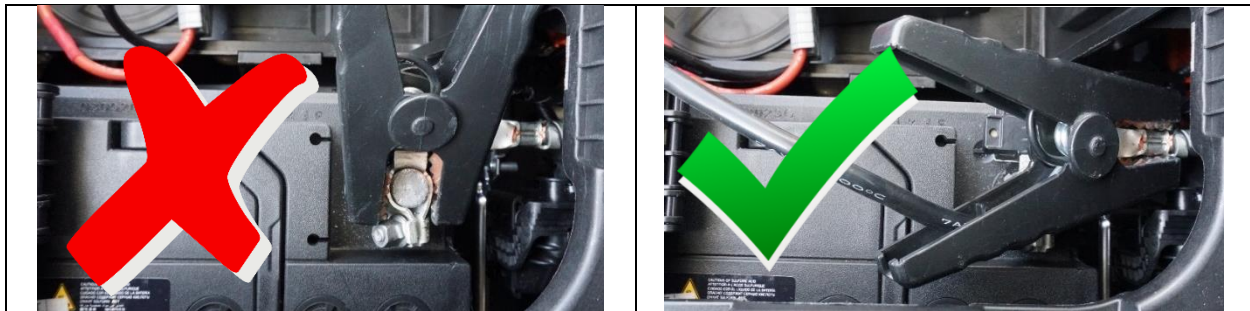



SUBJECT:

**OIL CHANGE REMINDER OPERATION LOGIC IMPROVEMENT (SA592)****① IMPORTANT**

It is recommended to **ALWAYS** check the Electronic Parts Catalog (EPC) to locate the ECU Part Number respective to Auto/Manual Mode ROM IDs. **DO NOT** reference the parts label affixed to the ECU.

**ROM ID INFORMATION TABLE:****Upgrade Event #757**

Model	Engine	IMMO		ECU P/No.	ROM ID	
					Previous	New
Seltos (SP2)	1.6L T-GDI GAMMA	Yes		91950 Q5015	2002 2003 2010	2011
				91950 Q5025		
				91950 Q5095		
				91950 Q5105		
				91950 Q5175		
				91950 Q5185		
				91950 Q5195		
				91950 Q5205		
				91950 Q5215		
				91950 Q5225		
				91950 Q5395		
				91950 Q5405		
				91950 Q5415		
				91950 Q5425		
91950 Q5435						
91950 Q5445						

*To verify the vehicle is affected, be sure to check the Calibration Identification of the vehicle's ECM ROM ID and reference the Information Table as necessary.*


**AVN SOFTWARE VERSION TABLE:**

Model	Platform	AVN SOFTWARE VERSION	
		Previous	New
Seltos (SP2)	GEN5W	SP2_PE.USA.S5W_M.V001.001.221213	SP2_PE.USA.S5W_M.V011.005.240409

**Software Information:**

The required software must be installed by selecting the **'Auto Mode'** ECU Upgrade option.

**Note:** In some case, the 'Manual Mode' installation option may be required **ONLY** if the 'Auto Mode' function fails or is otherwise noted above.

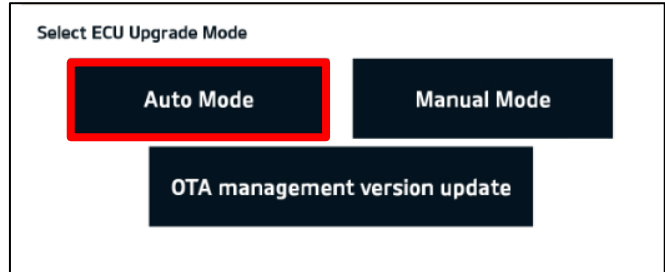

**NOTICE**

**If the automatic upgrade fails, turn the ignition 'OFF' for about 10 seconds then place it back in the 'ON' position to reset the control unit BEFORE performing the manual upgrade.**

**'Manual Mode' Passwords**


Menu	Password
SP2 PE ICU: 91950-Q5015/025/095/105/175/185/195/205/215/225/395/405/415/425/435/445	1343

**UPGRADE EVENT:**

- Select the applicable **'ICU'** system module and the Event Group.
  - 757.SP2 PE ICU Upgrade for Oil Change Reminder Reset Operation Logic"**

Verify the affected vehicle Calibration Identification of the applicable ECU ROM ID and reference the Information Table on page 3 as necessary.

- Confirm that the AVN SW is up to date after completing the ICU upgrade by proceeding to the 'AVN Software Inspection Procedure' on page 5.

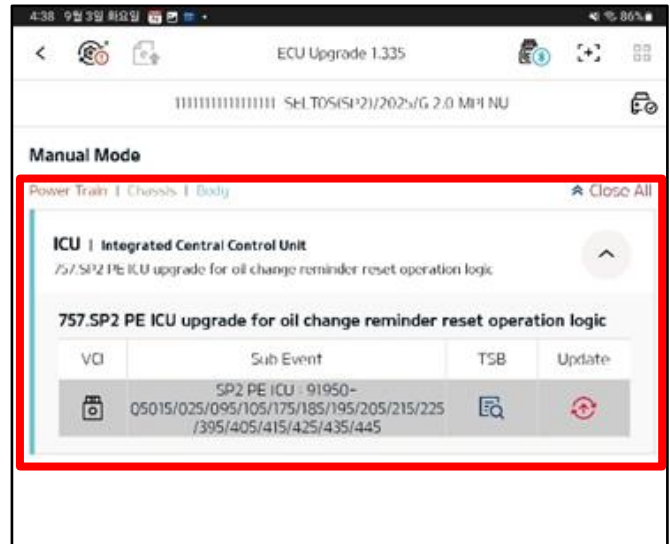

SUBJECT:


## OIL CHANGE REMINDER OPERATION LOGIC IMPROVEMENT (SA592)

## AVN Software Inspection Procedure:

1. Turn the vehicle 'ON'.




2. Select 'Confirm' on the head unit screen.

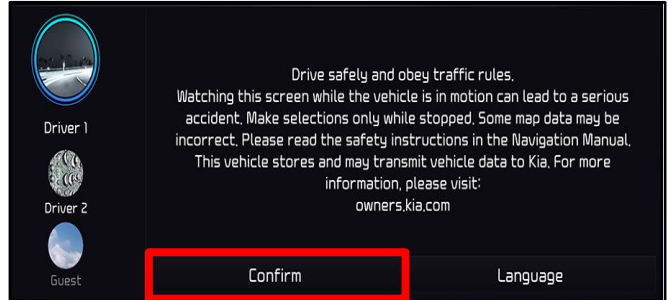


3. Select 'Setup'.



4. Select 'General'.

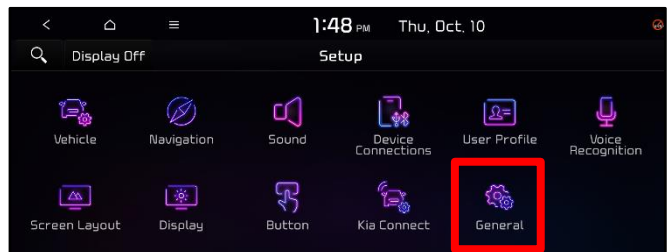

- 5a. Select 'SW Info/Update'.

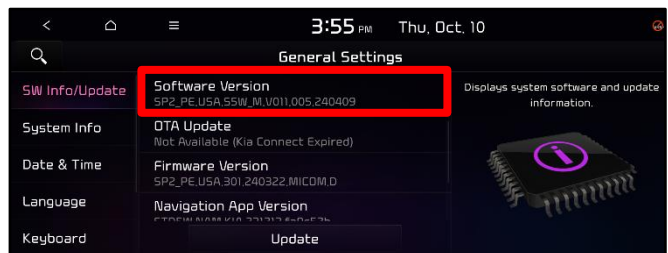

- 5b. Confirm that the latest AVN S/W is installed.

**SP2\_PE.USA.S5W\_M.V011.005.240409**

- If the software is up to date, no further action is required. **Claim "ICU Upgrade + AVN S/W Inspection" Op Code 240166R0.**
- If the software is not up to date, proceed to the 'AVN Software Update Procedure' on page 6.




**AVN Software Update Procedure:**

1. Repeat steps 1 - 4 of the 'AVN Software Inspection Procedure' on page 5.
2. Insert the provided USB drive into the USB slot.




3. Select one of the following:
  - If a pop-up displays, select 'OK'.
  - If a pop-up does not display, select 'Update'.

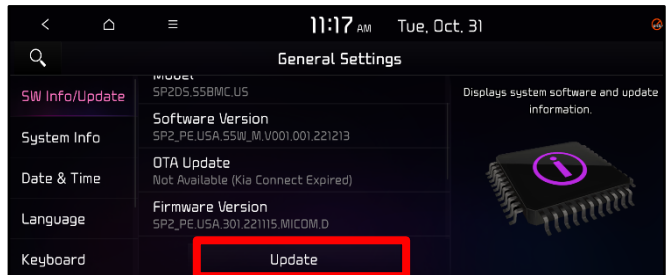


4. Select 'Start' on the pop-up.
 

**Note:** There may be multiple occurrences where the 'KIA' logo will appear, or the display may be black during the update process. This is normal.

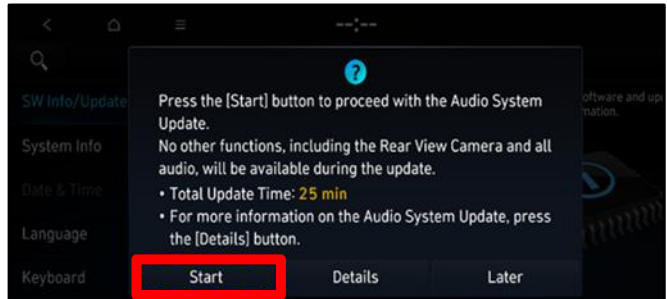

5. After AVN update is complete, verify the software version is the most current on the 'SW Info/Update' screen.

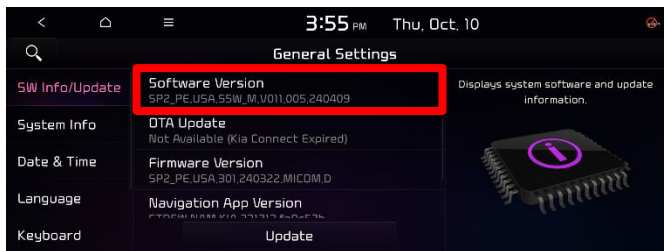



**SP2\_PE.USA.S5W\_M.V011.005.240409**

SUBJECT:

**OIL CHANGE REMINDER OPERATION LOGIC IMPROVEMENT (SA592)****AFFECTED VEHICLE RANGE:**

Model	Production Date Range
Seltos (SP2 PE)	February 14, 2023 to June 29, 2024

**REQUIRED TOOL:**

Tool Name	Part Number	Figure	Comments
KDS 2.0	N/A		Kia Diagnostic System
USB Flash Drive Seltos Maintenance Reminder (SA592 / ELE359)	SP2GEN5W		Auto-Distributed To Dealers October 2024

**Note:** Additional USB Flash Drives (SST PN SP2GEN5W) can be ordered through Snap-on Business Solutions at (888) 542-1011.

**WARRANTY INFORMATION:**

**N Code: N99 C Code: C99**

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
V	91950 Q5405	0	(SA592) ICU S/W Upgrade + AVN S/W Inspection	240166R0	0.4 M/H	N/A	0
			(SA592) ICU S/W Upgrade + AVN S/W Inspection + S/W Update	240166R1	0.7 M/H		

**Note:** For Substitute Transportation policy, please refer to Service Policy and Procedures Manual (SPPM) 6.11 "Kia Substitute Transportation".

**NOTICE**

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference **SA592** when accessing the KDealer+ system.

