



Service Bulletin

Bulletin No.: 25-NA-101

Date: April, 2025

INFORMATION

Subject: Information on Airbag Light on with DTC U3000.7B and/or U3000.49 set in the Passenger Presence Module


Brand:	Model:	Model Year:		VIN:		Engine:	Transmission :
		from	to	from	to		
Cadillac	Escalade	2022	2025				
	Escalade ESV	2022	2025				
Chevrolet	Colorado	2022	2025				
	Silverado 1500 LTD (RPO J21, VIN Digit 5= W/Y)	2022	2022				
	Silverado 1500 NEW (RPO J22, VIN Digit 5= A/D)	2022	2022				
	Silverado 1500	2023	2025				
	Suburban	2022	2025				
	Tahoe	2022	2025				
GMC	Canyon	2022	2025				
	Hummer EV	2022	2025				
	Sierra 1500 Limited (RPO J21, VIN Digit 5= 8/9)	2022	2022				
	Sierra 1500 NEW (RPO J22, VIN Digit 5= H/U)	2022	2022				
	Sierra 1500	2023	2025				
	Yukon	2022	2025				
	Yukon XL	2022	2025				

Involved Region or Country	Canada, Mexico, Europe, Kazakhstan, Uzbekistan, Russia, Middle East, Iraq, Israel, Palestine, Argentina (Mercosur), Brazil (Mercosur), Bolivia (West), Chile (West), Colombia (West), Ecuador (West), Paraguay (West), Peru (West), Uruguay (West), Venezuela (West), Japan, S. Korea, China - SGM, China GMPI, Taiwan , Thailand (ASEAN), Singapore, Philippines, Australia/New Zealand, Egypt, Other Africa
Condition	Some customers may comment on the restraint warning lamp being illuminated.
Cause	The cause of the condition may be that some chemicals when sprayed in the vicinity of the passenger presence module may block or contaminate the atmospheric reference ports. These chemicals include, body sprays, anti-static sprays, window cleaner, silicones etc. Important: The sensor should not be sprayed with cleaners or chemical protectants during cleaning or pre-delivery inspection.
Correction	Replace the contaminated passenger presence module. And use care when cleaning near the module reference port.

Service Procedure

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.


Important: This technical service bulletin (TSB) can only be completed by certified repair facilities who have met all specific training, tool, and equipment requirements pertaining to the vehicle Brand and Model serviced. Repairs must be performed by a technician who has successfully completed the required training.

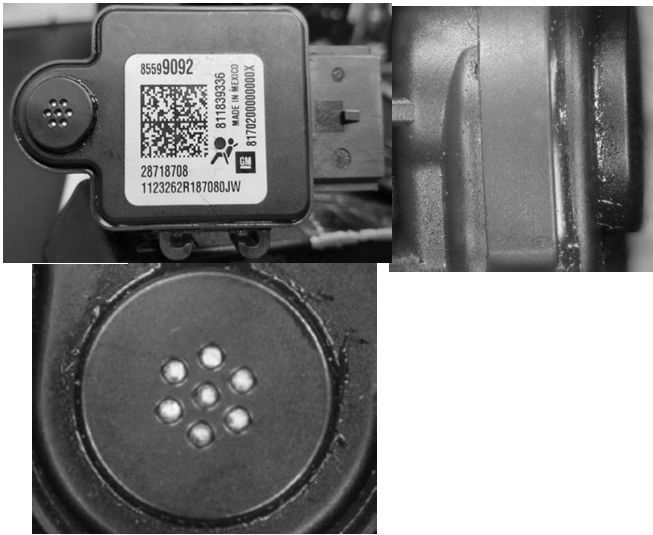

6903655



6903657

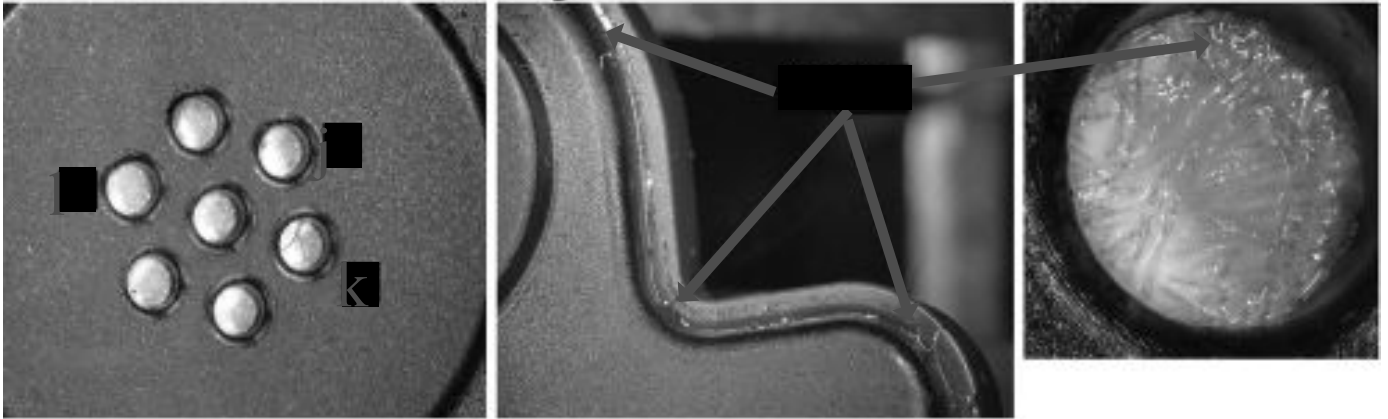

6903684

Replace the contaminated Passenger Presence Module. Contaminated pictures are shown above with clear liquid residue shown in pictures. Refer to *Airbag Front Passenger Presence Module Replacement* in SI.



6903652

The sensor is located under the front of the passenger's seat, about 100mm from the front of the seat as seen in the picture above.

When cleaning the passenger's seat area, spray should be applied to a rag and the parts wiped as described in the owner's manual under "vehicle care".

Caution: Use cleaners specifically designed for the surfaces being cleaned to prevent permanent damage to the vehicle. Apply all cleaners directly to a cleaning cloth. Do not spray cleaners on any switches or controls.

Parts Information

Causal Part	Description	Part Number	Qty
X	MODULE ASM-AIRBAG FRT PASS PRESENCE (W/SEN)	85599092	1

Warranty Information

Repairs of this type are not covered by the warranty. The owner's manual states that chemicals are not to be sprayed into electrical components and switches in the interior.

Version	1
Modified	Released April 29, 2025

