



Service Bulletin

Bulletin No.: PIP6031A

Date: June, 2025

PRELIMINARY INFORMATION

Subject: CVT Transmission Leaks From Case Half

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Encore GX	2022 - 2025		All	All	All	MRG
Chevrolet	Equinox	2025		All	All	All	MRQ
Chevrolet	Malibu	2022 - 2025		All	All	All	MRG
Chevrolet	Trailblazer	2022 - 2025		All	All	All	MRG
GMC	Terrain	2025		All	All	All	MRQ

Involved Region or Country	North America
Condition	Transmission leaks from the case half.
Cause	Machining Issues on the case.

Correction

Some Customers may comment on a leak from the transmission.

Technicians may find a leak coming from the case halves.


Now that tool GM-52317 is available we can separate the case and repair.

If a leak is found in this location, then follow the video in the Emerging issues 10224.07V in Center of Learning (US Dealers) or 57550.01V (Canadian Dealers) to separate the case halves.


Separate the Case halves and inspect for Machining damage.

Machining Damage as seen below can be repaired by block sanding the case with either 400 or 600 grit sandpaper then replacing the gasket.

Note: When sanding the case attention must be paid to prevent taking off too much metal, all that needs to be done is to remove the machining damage to the case.

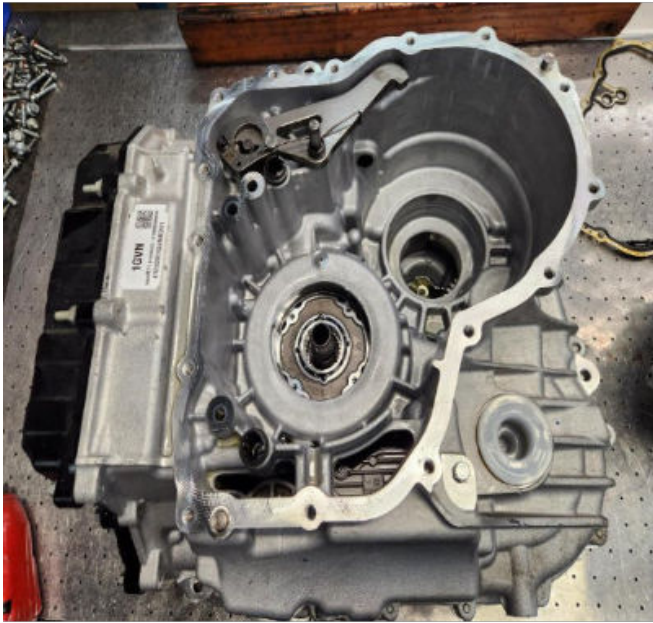

6750270

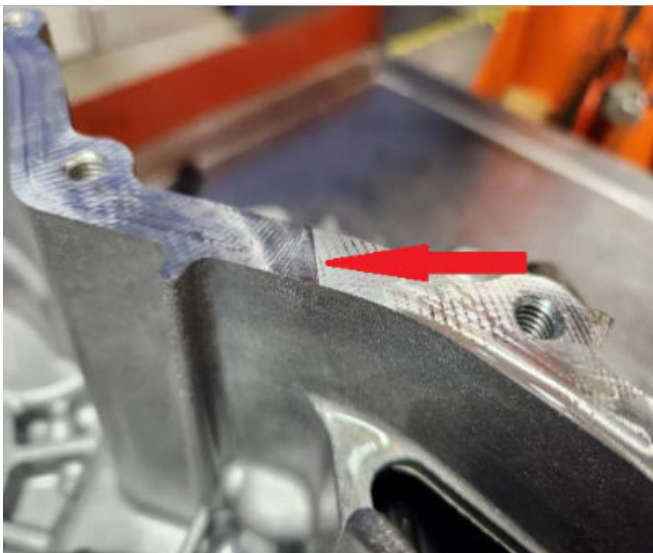

6782719

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4082428*	Repair machining imperfection by block sanding	0.2
*This is a unique Labor Operation for Bulletin use only.		

Version	2
Modified	12/11/2024 - Created on. 06/09/2025 - Updated to include COL course 57550.01V for Canadian Dealers and the 2025 GMC Terrain and Labor Operation and Models.

