



# Service Bulletin

Bulletin No.: PIP5781C

Date: June, 2025

## PRELIMINARY INFORMATION

**Subject: Dual Clutch Transmission MCVM PUN clarification**

| Brand:    | Model:   | Model Year: |    | VIN: |     | Engine: | Transmission: |
|-----------|----------|-------------|----|------|-----|---------|---------------|
|           |          | from        | to | from | to  |         |               |
| Chevrolet | Corvette | 2020-2024   |    | All  | All | All     | All           |

|                                   |  |
|-----------------------------------|--|
| <b>Involved Region or Country</b> | North America, Middle East, Japan and Holden (GM SV) |
| <b>Condition</b>                  | Required parts replacement needing characterization. |
| <b>Cause</b>                      | Service procedures have changed.                     |

### Correction

Service information repair procedures have changed and some technicians are still attempting to characterize MCV and Direct clutch PUNs in the TCM. These 2 parts NO LONGER REQUIRE CHARACTERIZATION when being replaced.

You MUST still characterize SAV (Shift Activation Valve) and transmission assembly replacements.

The supplier uses a 21 digit PUN for production parts and we characterize a 22 digit PUN in service. When we direct ship a production part it does not contain the 22 digit PUN required for characterization. Performing Service Fast Learn after either of these two parts are changed will allow the TCM to adequately learn the flow and fill characteristics of the new parts.

If you tried to characterize direct clutch or MCV pun numbers and it fails, select "Refresh Characterization Data" as shown below and use the TUN number from the transmission assembly.

| Select Controller |  |
|-------------------|--|
| A11               | Radio  |
| A22               | Radio Control  |
| K36               | Restraints Control Module                                    |
| K85P              | Restraints Occupant Classification System Module - Passenger |
| K56               | Serial Data Gateway Module                                   |
| B218              | Side Obstacle Detection Control Module                       |
| K73               | Telematic Control Module                                     |
| <b>K71</b>        | <b>Transmission Control Module</b>                           |
| K161              | Vehicle Performance Data Recorder                            |
| K157              | Video Processing Control Module                              |
| T22               | Wireless Accessory Charging Module                           |

  

| Select Function / Sequence |
|----------------------------|
| Programming                |
| <b>MCVM Operations</b>     |
| Setup                      |

  

| Select Programming Type |
|-------------------------|
| <b>Normal</b>           |
| VCI                     |

5735801

Please, select MCVM Operation to be performed:

- Replace Transmission
- Replace Characterized Transmission Components
- Refresh Characterization Data

5735802

Please, enter valve body assembly PUN (Part Unique Number):

5735803

|                 |  |
|-----------------|--|
| <b>Version</b>  | 3  |
| <b>Modified</b> | 02/08/2021 - Created on.<br>01/05/2024 Updated to change MCV and direct clutch no longer required to characterize.<br>05/10/2024 Updated to add Holden and added RPO MLH |

