



Service Bulletin


Bulletin No.: PIP6072

Date: June, 2025

PRELIMINARY INFORMATION

Subject: R1234YF Flush Error Message Information

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
BrightDrop	Zevo 400	2024		All	All	All	All
Brightdrop	Zevo 600	2024		All	All	All	All
Cadillac	Escalade IQ	2025-2025		All	All	All	All
Cadillac	Escalade IQL	2026		All	All	All	All
Cadillac	Lyriq	2023-2025		All	All	All	All
Cadillac	Optiq	2025		All	All	All	All
Cadillac	Vistiq	2026		All	All	All	All
Chevrolet	Brightdrop 400	2025		All	All	All	All
Chevrolet	Brightdrop 600	2025		All	All	All	All
Chevrolet	Blazer EV	2024-2025		All	All	All	All
Chevrolet	Equinox EV	2024-2025		All	All	All	All
Chevrolet	Silverado EV	2024-2025		All	All	All	All
GMC	Hummer EV	2022-2025		All	All	All	All
GMC	Hummer EV SUV	2024-2025		All	All	All	All
GMC	Sierra EV	2024-2025		All	All	All	All

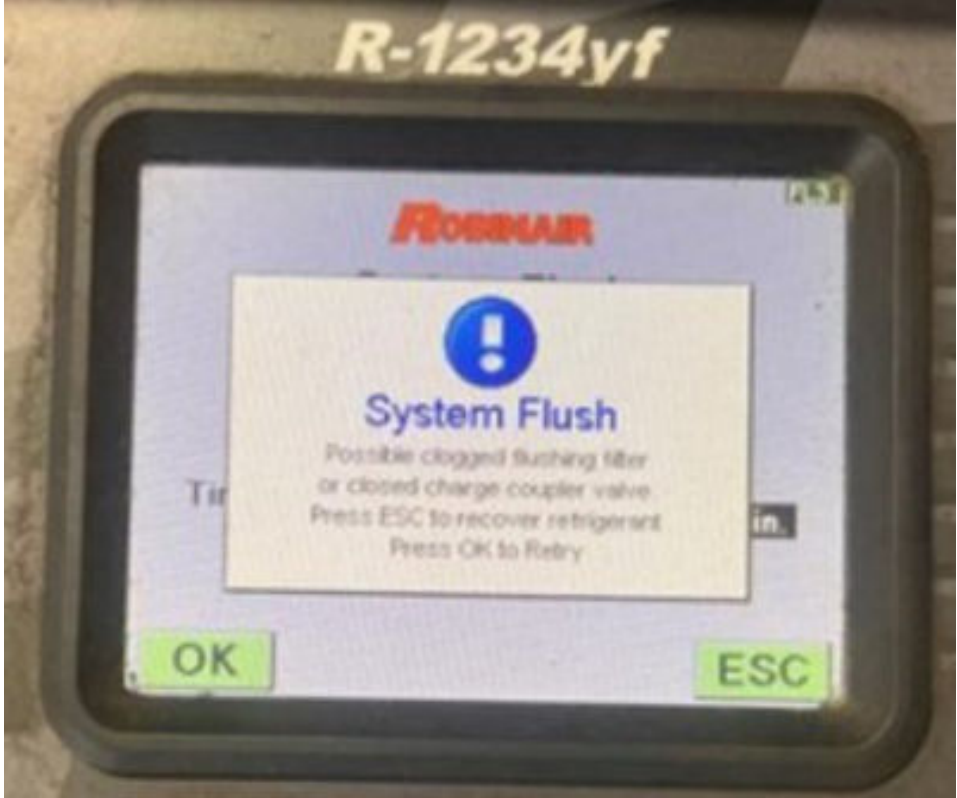Involved Region or Country	North America
Condition	<p>While performing refrigerant flushing procedures, dealers may encounter an error message on their equipment indicating there is a possible clogged flushing filter or closed charge coupler valve when the filter is clear and the charge coupler valve is open.</p>  <p style="text-align: right;">6954820</p>
Cause	<p>A possible cause for this condition is that a restriction is detected by the equipment due to design changes between older flushing adapters (GE-45268-130) and new revisions of the adapters (GE-45268-130-A).</p> <p>When service equipment is connected to the GE-45268-130, and the knob on the back of the quick connect is tightened, the core depressor in the quick connect end blocks the passage of refrigerant through the adapter.</p>


Correction

If dealers encounter this error message and determine that it is being caused by an incorrect adapter, they are encouraged to order the appropriate adapter through the Dealer Equipment and Special Tools portal in Global Connect whenever possible.

Based on supplier feedback certain adapters may not be available for immediate purchase through the portal in Global Connect.

The passage through the middle of the GE-45268-130-A adapter is the size of a 1/4 inch drill bit and the prior adapter GE-45268-130 has a smaller opening.

Our suppliers are working to remedy this situation by modifying their inventory of the GE-45268-130 adapter to meet GE-45268-130-A standards by enlarging the passage through the adapter or by acquiring the correct revision of the adapter to make them available for dealers.

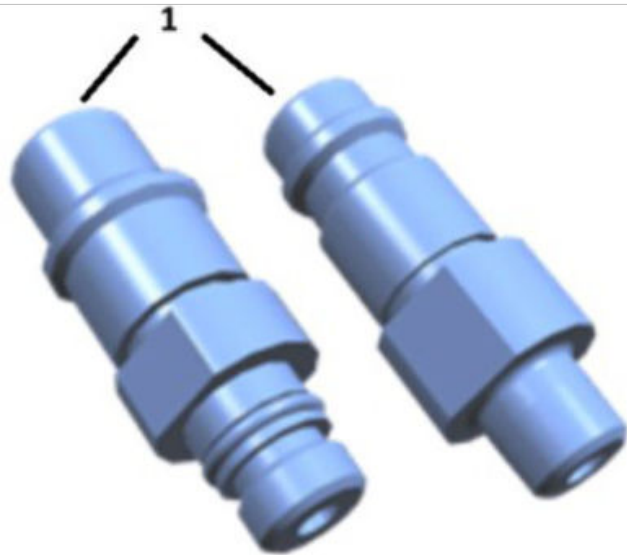

6954821

1 Above shows the portion of the adapter that should have a 1/4 inch opening

Version	1
Modified	6/16/2025 - Created on