



# Service Bulletin

Bulletin No.: PIT6302A

Date: June, 2025

## PRELIMINARY INFORMATION

**Subject: Rubbing / Scraping Noise When Turning The Steering Wheel**


Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade	2025		All	All	All	All
Cadillac	Escalade ESV	2025		All	All	All	All
Cadillac	Escalade IQ	2025-2026		All	All	All	All
Cadillac	Escalade IQL	2026		All	All	All	All
Chevrolet	Silverado EV	2024-2026		All	All	All	All
Chevrolet	Suburban	2025		All	All	All	All
Chevrolet	Tahoe	2025		All	All	All	All
GMC	Sierra EV	2024-2026		All	All	All	All
GMC	Yukon	2025		All	All	All	All
GMC	Yukon XL	2025		All	All	All	All

<b>Involved Region or Country</b>	North America
<b>Condition</b>	Some customers may comment on hearing a rub or scrape noise when turning the steering wheel left or right.
<b>Cause</b>	The noise could be the steering column trim covers contacting the steering wheel due to the turn signal switch bracket (1) not fully seated/installed onto the column tube, shown below (3).


### Correction

To correct this concern, loosen the turn signal switch bracket band clamp bolt (2) and then fully push the turn signal bracket onto the steering column tube until it is fully seated, as shown below (4). Reassemble and test to verify the noise is gone.


**Note:** If additional information is needed on how to access the turn signal switch bracket band clamp bolt, see SI procedure for "Turn Signal Switch Bracket Replacement" example Document ID: 6725993.

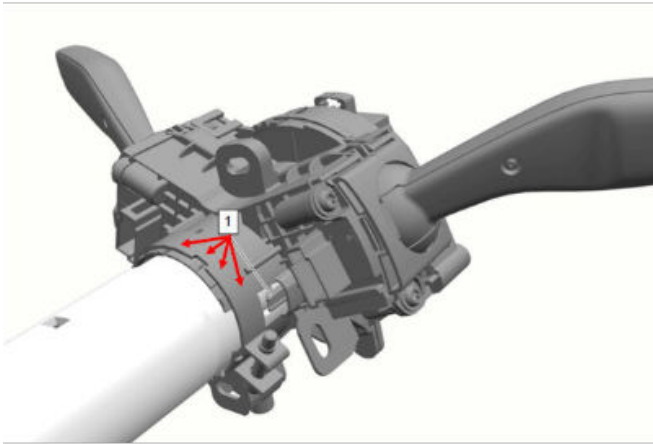

6781979

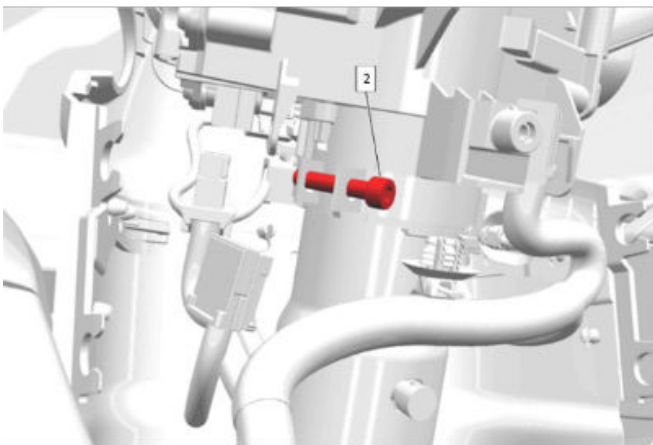

6781980

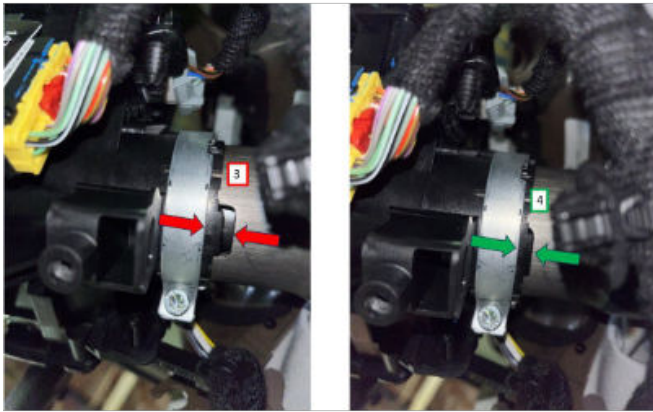

6781981

**Parts Information**

**Note:** NO PARTS REPLACEMENT NEEDED

**Warranty Information**

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage.

Labor Operation	Description	Labor Time
7440360	Turn Signal Switch Bracket Replacement *	Use Published Time
*NO NEED TO ACTUALLY REPLACE THE BRACKET		

Version	2
Modified	12/13/2024 - Created on. 06/18/2025 - Updates to the model list

