



Service Bulletin

Bulletin No.: PIP6071A

Date: June, 2025

PRELIMINARY INFORMATION

Subject: Potential Chuggle, Surge, Hesitation on Acceleration, Misfire, P0300, P2097, P2251, P223C

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Equinox	2023-2026		All	All	1.5 LSD	All
GMC	Terrain	2023-2026		All	All	1.5 LSD	All

Involved Region or Country	North America
Condition	Customers may notice a surge, misfire, chuggle, hesitation at tip in acceleration or MIL with P0300, P2097, P2251 P223C stored. More noticeable on units built prior to May 27 2025
Cause	Potential skewed position 1 oxygen sensor.

Correction

Replace the position 1 oxygen sensor, perform any applicable learn, and retest. Inspect the catalytic converter while sensor is out of the bore for any potential degradation to the catalyst bed.

Parts Information

Refer to GM EPC for parts information per specific VIN.

Version	2
Modified	06/13/2025 created on. 06/30/2025 Update to add Model Year 2026.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, **DO NOT** assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



**WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION**

Copyright 2025 General Motors. All Rights Reserved.