

Subject: CHECK ENGINE LIGHT ON WIT DTCS P0012, P0011, AND POSSIBLY P0010	Service Alert No.: SA-033/25
	Last Issued : 06/20/2025

BULLETIN NOTES

APPLICABLE MODEL(S)/VINS

2024-2025 CX-90 MHEV (H3T inline 6) with VIN lower than JM3KK*****199541 (produced before August 26, 2024)
 2025 CX-70 MHEV (H3T inline 6) with VIN lower than JM3KJ*****117742 (produced before August 26, 2024)


DESCRIPTION

Some vehicles may experience a CHECK ENGINE light ON with DTC P0012, P0011, and possibly P0010. This may be caused by a malfunction in the intake EVVT motor that prevents it from accurately regulating the intake camshaft timing.

REPAIR PROCEDURE

According to the WSM, replace the intake EVVT motor #13 with an updated EVVT motor.

NOTE: DO NOT replace the cam actuator #9.

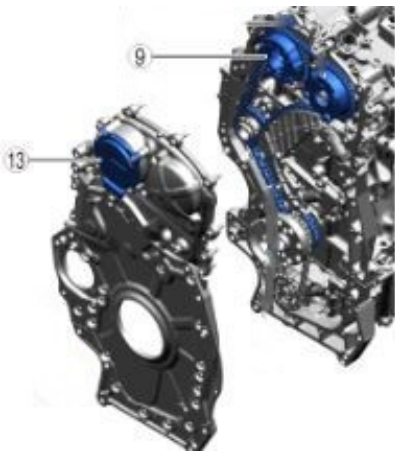

PARTS INFORMATION

Parts Number	Description	Qty.
T3011-24-Z0E	EVVT Motor	1

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

T301-12-257

EVVT Motor O-ring

1

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.