



## **SSM 53981 2021-2024 Bronco - Window Rattle From The Front Doors Over Bumps**

Some 2021-2024 Bronco vehicles may exhibit a rattle from the front windows with the windows placed in the partially down position and driving over rough roads and/or bumps. This may be due to the interface between the window glass and the body mounted glass run. To correct this condition, replace the body mounted glass runs using the body mounted glass run kit (3 door: M2DZ-9821597-E, and 5 door: M2DZ-7821597-F) which contains updated seals for improved sealing performance. For claiming, use causal part 9821597/7821597 and labor operations 23943A and 23943A19 in Section 12 of the Service Labor Time Standards (SLTS) Manual.