



## **SSM 53994 2023-2025 F-Super Duty - No Crank/No Start Or Intermittent No Crank/No Start With DTC U0100**

Some 2023-2025 F-Super Duty vehicles may exhibit a no crank/no start with diagnostic trouble code (DTC) U0100 in various modules. This condition may be due to the ground connection at G113. Inspect G113 for proper connection and tighten to 12 +/- 1.8 Nm. If condition remains after tightening G113, continue with normal diagnostics. Refer to Workshop Manual, Section 303-06 Starting System.