

<b>Reference</b>	SSM76332
<b>Models</b>	F-PACE / X761
<b>Title</b>	25MY and newer Walk Away Lock / Approach Unlock not operational due to RFA software limitation.
<b>Category</b>	Body
<b>Last modified</b>	02-Jun-2025 00:00:00
<b>Symptom</b>	112000 Latches/Locks & Security

**Content**Issue:

- Walk Away Lock / Approach Unlock function is not operational. If the feature is enabled through touch screen, this may set RFA DTC U3000-95.
- This DTC indicates that the RFA does not currently support the door handle hardware vehicle is equipped. This will not result in customer message or affect vehicle performance.

Cause:

- The RFA is currently unable to support the Walk Away Lock / Approach Unlock function with non-deployable door handles due to limitations in software capability.
- This will be addressed in upcoming RFA software release.

Action:

1. If DTC U3000-95 is seen in affected vehicle, do not replace the RFA. DTC is expected and can be ignored as it will not adversely affect vehicle performance.
2. If customer has noted concern with lack of Walk Away Lock / Approach Unlock function no operating, advise of upcoming software and schedule for service visit to once RFA software is available for install.

SSM will be updated to once software is released and available.

anBhdHRlcnM7MjAyNS0wNj0wM1QxNjoxNjcyNi44ODZzOzE0Ny4xNjEwMj0LjE2NTs=