

<b>Reference</b>	SSM76333
<b>Models</b>	Discovery / L462 Discovery Sport / L550
<b>Title</b>	25MY and newer Walk Away Lock / Approach Unlock not operational due to RFA software limitation.
<b>Category</b>	Body
<b>Last modified</b>	02-Jun-2025 00:00:00
<b>Symptom</b>	112000 Latches/Locks & Security
<b>Content</b>	<p><u>Issue:</u></p> <ul style="list-style-type: none"> <li>• Walk Away Lock / Approach Unlock function is not operational. If the feature is enabled through touch screen, this may set RFA DTC U3000-95.</li> <li>• This DTC indicates that the RFA does not currently support the door handle hardware vehicle is equipped. This will not result in customer message or affect vehicle performance.</li> </ul> <p><u>Cause:</u></p> <ul style="list-style-type: none"> <li>• The RFA is currently unable to support the Walk Away Lock / Approach Unlock function with non-deployable door handles due to limitations in software capability.</li> <li>• This will be addressed in upcoming RFA software release.</li> </ul> <p><u>Action:</u></p> <ol style="list-style-type: none"> <li>1. If DTC U3000-95 is seen in affected vehicle, do not replace the RFA. DTC is expected and can be ignored as it will not adversely affect vehicle performance.</li> <li>2. If customer has noted concern with lack of Walk Away Lock / Approach Unlock function no operating, advise of upcoming software and schedule for service visit to once RFA software is available for install.</li> </ol> <p>SSM will be updated to once software is released and available.</p>

anBhdHRlcnM7MjAyNS0wNi0wM1QxNjoxMzozM41NzBzOzE0NjY4NjEuMj0LJE2NTs=