

 Connection offline

Vehicle-specific service

Topic	94 PSS Warning lamp in instrument cluster "Left/Right main beam headlight defective DTC: C12FC01
Market area	United States 444 Volkswagen of America, Inc. (6444)
Brand	Audi
Transaction No.	2078182/1
Level	EH
Status	Released for publishing
Release date	Jun 24, 2025

Vehicle data

Q5

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
GU*	2025	A		*	*	*

Chassis numbers

Manufacturer	Filler	Type	Filler	MY	Factory	From	To	Prod from	Prod to
*	*	GU	*	*	*	000001	999999		

Documents

Document name
master.xml

 Connection offline

Vehicle-specific service

Transaction No.: **2078182/1**

94 PSS Warning lamp in instrument cluster "Left/Right main beam headlight defective
DTC: C12FC01

Release date: Jun 24, 2025

Condition

This PSS applies only to Q5 (GU) variants.

Customer statement:

- The yellow warning message "Left/right main beam headlight defective. See owner's manual" appears in the instrument cluster while driving.
- There are no functional restrictions in the main beam headlights.
- The warning lamp disappears after switching the ignition off and then on again but subsequently appears intermittently.

Workshop findings:

The complaint can be reproduced.

- **DTC C12FC01** LED channel 4, electrical fault, symptom 139272 is logged in diagnostic address 0029 (Left light control) and/or 0039 (Right light control).

There are no functional restrictions in the main beams/additional main beams.

Technical Background

Software issue.

Production Solution

A new ZDC version will be available for the control units with diagnostic addresses 0029 (Left light control) and 0039 (Right light control) from approx. the end of week 26/2025 onwards.

This new ZDC version will be installed in the corresponding control unit using software configuration.

Service



This PSS may apply to vehicles still in the new model launch repair authorization period!

- **For vehicles still in launch phase, create a TAC case per the repair authorization in addition to entering vehicle into the PSS Database. Reference this TSB in the TAC case.**

1. Explain to the customer that a solution is expected to be available by the end of the 2nd quarter of 2025 (subject to change) and that no repairs are necessary at this point.
2. Do not replace any components for this condition since this will not resolve the customer's concern.
3. Create a PSS record in the PSS application through the Pending Service Solutions (PSS) link in AccessAudi (under *Related Links >> Service*).

Warranty

This TSB is informational only and not applicable to any Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2078182**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©**2025 Audi of America, Inc.** All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.