

Technical Service Bulletin

Topic	91 Replacing reversing camera system control unit J772 + control unit for overhead view camera J928; Reference 2078219
Market area	United States 444 Volkswagen of America, Inc. (6444)
Brand	Audi
Transaction No.	2078367/1
Level	EH
Status	Released for publishing
Release date	Jun 27, 2025

New customer code

Object of complaint	Complaint type	Position
assistance systems, comfort controls -> Parking Aid, Park Assist, Rear Traffic Alert -> reverse camera image	functionality -> faulty	
assistance systems, comfort controls -> Parking Aid, Park Assist, Rear Traffic Alert -> reverse camera image	functionality -> does not switch on/connect	
assistance systems, comfort controls -> Parking Aid, Park Assist, Rear Traffic Alert -> reverse camera image	functionality -> switches off by itself	
assistance systems, comfort controls -> Parking Aid, Park Assist, Rear Traffic Alert -> reverse camera image	functionality -> misfire	

New workshop code

Object of complaint	Complaint type	Position
vehicle service -> IT systems -> SVM (Software Version Management) -> SVM (software version management) part replacement	functionality -> cannot be started	

Vehicle data

A5, A6, A6 e-tron, Q5, Q6 e-tron

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
GU*	2025	A		*	*	*
GH*	2025	A		*	*	*
GF*	2025	A		*	*	*
FU*	2025	A		*	*	*

PR numbers

PR numbers
? :with KA4
? :or ? :with KA2

Documents

Document name
master.xml
attachment1.jpg
schnellere_bearbeitung.jpg

Condition



This TSB only applies and must only be used if you are instructed to refer to it by ETKA. You were instructed to refer to this TSB (or TPI 2078219) by ETKA when replacing reversing camera system control unit -J772- or Peripheral camera system control unit -J928-.

Technical Background

Due to software issues, it is only possible to supply new part versions of reversing camera system control unit -J772- or Peripheral camera system control unit -J928-.

The new part versions of reversing camera system control unit -J772- or Peripheral camera system control unit -J928- require additional start-up steps to ensure compatibility with the vehicle baseline.

Production Solution

Not applicable.

Service

Use the table below to determine the vehicle model and camera system version (PR number) as well as the suggested part version/basis in ETKA and perform the instructions provided for ordering and starting up the control unit in question.

Vehicle model	PR number	Suggested part version/basis in ETKA	Instructions for ordering and starting up
Q6 e-tron (GF) A6 e-tron (GH)	KA2 / KA4	85E980568H	The part number with index H has been discontinued. Please order and install part number 85E980568P and perform the following start-up steps: <ol style="list-style-type: none">1. Activate the new component via the "Replace control module" test program.2. Check the vehicle for any open field campaigns in ELSA and perform these as necessary.3. After completing step 2 successfully, perform the update in accordance with TSB 2077960.
Q6 e-tron (GF) A6 e-tron (GH)	KA4	85E907428H	The part number with index H has been discontinued. Please order and install part number 85E907428P and perform the following start-up steps: <ol style="list-style-type: none">1. Activate the new component via the "Replace control module" test program.2. Check the vehicle for any open field campaigns in ELSA and perform these as necessary.

			3. After completing step 2 successfully, perform the update in accordance with TSB 2077960.
Q6 e-tron (GF) A6 e-tron (GH)	KA2 / KA4	85E980568N	The part number with index N has been discontinued. Please order and install part number 85E980568P and perform the following start-up steps: 1. Activate the new component via the “Replace control module” test program. 2. Perform the update in accordance with TSB 2077960.
Q6 e-tron (GF) A6 e-tron (GH)	KA4	85E907428N	The part number with index N has been discontinued. Please order and install part number 85E907428P and perform the following start-up steps: 1. Activate the new component via the “Replace control module” test program. 2. Perform the update in accordance with TSB 2077960.
A5 (FU) Q5 (GU) A6 (FN)	KA2 / KA4	85E980568H	The part number with index H has been discontinued. Please order and install part number 85E980568N and perform the following start-up steps: 1. Activate the new component via the “Replace control module” test program. 2. Check the vehicle for any open field campaigns in ELSA and perform these as necessary.
A5 (FU) Q5 (GU) A6 (FN)	KA4	85E907428H	The part number with index H has been discontinued. Please order and install part number 85E907428N and perform the following start-up steps: 1. Activate the new component via the “Replace control module” test program. 2. Check the vehicle for any open field campaigns in ELSA and perform these as necessary.

Warranty

This TSB is informational only and not applicable to any Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2078367**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2025 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.