

**Symptom in Vehicle Interior - Map Details Missing in Some Regions: Programming Navigation Update Using SD Card (SY 108/19)**

Change Overview:

Release	Date	Modification
0	11/21/2019	▪ Original Publication
1	05/23/2022	▪ Addition of latest part numbers
2	6/10/2025	▪ Update with latest part numbers

Model Year: **As of 2018**

Model Line: **Cayenne (9YA)**  
**Macan (95B)**

Subject: **Navigation map data on central computer**

Symptom: Map details such as roads and rivers are missing in the Map view in some regions. These areas are distinctly demarcated, especially at a low zoom level.

Cause: An incorrect file in the navigation map data on the central computer can result in the loss of regional map details.

Remedial Action:



**Information**

The central computer update using the SD card is not a map update, only the original map content details will be restored.

Program navigation update using SD card, see ⇒ *Workshop Manual '915225 Programming navigation update on central computer'*.

Parts Info: Always use the most current available software update.

Part No.	Market	Designation	Qty.
9P1909000CF	NAR - North America	SD card — PCM 4	1
9Y0909000AH	NAR - North America	SD card — PCM 5	1

Tools: **Battery charger** with a current rating of **at least 90 A**, e.g. **Battery Charger, 90 A**

**Invoicing**

Invoicing: For documentation and warranty invoicing, enter the labour operation and PQIS coding specified below in the warranty claim:

APOS	Labor operation	I No.
91522504	Programming central computer (31 TU)	

PQIS coding:

Location (FES5)	91520	Central computer
Damage type (SA4)	1612	Does not function in some cases

References: ⇒ *Workshop Manual '915225 Programming navigation update on central computer'*

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2025 Porsche Cars North America, Inc.