

## Technical Journal

TITLE:

**Reduced Performance Message After AC Charging**

<b>REF NO:</b> TJ 37273.2.0	<b>ISSUING DEPARTMENT:</b> Technical Service	<b>CAR MARKET:</b> United States and Canada	
<b>PARTNER:</b> 3 US 7515 Polestar		<b>ISSUE DATE:</b> 2025-06-13	<b>STATUS DATE:</b> 2025-06-24
<b>FUNC GROUP:</b> 3233	<b>FUNC DESC:</b> Electric converter, high voltage	<b>Page 1 of 2</b>	

Rows beginning with \* are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

### DESCRIPTION:

\*Updated VST operation No., Vehicle Type, and Service.

A customer may experience a DIMD message stating “Reduced Performance” after AC charging is finished and the vehicle is still connected to the AC charger. If this symptom occurs and one or more of the DTCs listed below are set, please follow the advice under “Service”.

DIM = Driver Information Module Display

### CSC Customer Symptom Codes

Code	Description
53	Driving, Twin Engine/Propulsion using electric motor not possible
7G	Text window and warning symbol/Yellow symbol and text message
IV	Text window and warning symbol/Text message
DL	Warning lights and chimes/Malfunction Indicator Light ("Check engine" light) indication/no indication

# Technical Journal 37273.2.0

## DTC Diagnostic Trouble Codes

Control Module	Code	Fault Type
IHRA	P0A7A66	Permanent
IHRA	P0A7A66	Intermittent
IHFA	P0A7A66	Permanent
IHFA	P0A7A66	Intermittent
IHFA	P060C66	Permanent
IHFA	P060C66	Intermittent
IHRA	P060C66	Permanent
IHRA	P060C66	Intermittent

## Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
359							2024-2025		-	202402-202524

## SERVICE:

\*Do not replace any parts.

A software solution was introduced with version 1.3.17. Perform a software upgrade according to TJ 35361.

## Warranty claim info:

To get a warranty claim accepted for a job described in this TJ, use the corresponding VST OP number stated in this TJ.

Note that the TJ number must be stated in the repair order text.

## VST Operation Number

VST Operation Number	Description
36004-2	Software Control Module downloading

## LABOR TIME:

Labor time subject to change without notice.

## VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report Polestar" and sub concern area "Support Needed Polestar", use function group 3233.