

Subject		Market	
Installation Tip for Seat Side Shield		USA	
Service Category		Section	
Vehicle Interior		Seat	
Applicability			
2022-2025 Tundra Tundra HV Sequoia HV			

### APPLICABLE VEHICLES

2022-2025	Tundra	2023-2025	Sequoia HV
2022-2025	Tundra HV		

### CONDITION

Customers may experience the front seat side shield cracking on the lower portion as shown on figure 1. The lower clip attachment point may not be seated due to mispositioning during shield installation. If not properly aligned during installation clip will shift up and sit on top of attachment point as shown on figure 2.

### RECOMMENDATIONS



Figure 1: Side shield cracking View



Figure 2: 3<sup>rd</sup> clip mis-installed

Re-install of the seat cushion side shield by following the repair manual instructions listed in the link references below.

For aid during installment procedure, view videos 1-3 clip installation for verification of good engagement .



1st dip installation 2nd dip installation 3rd clip installation

Subject

**Seat Side Shield Cracking on lower portion after replacement using latest parts**

Market

USA

Applicability

## RECOMMENDATIONS

Note: This condition may happen again if new seat shield replacement is not installed properly. It is strongly recommended to perform visual check after installation to confirm attachment clip is fully engaged. See figure 3 for illustration.

Shield Lower Clip – How to inspect

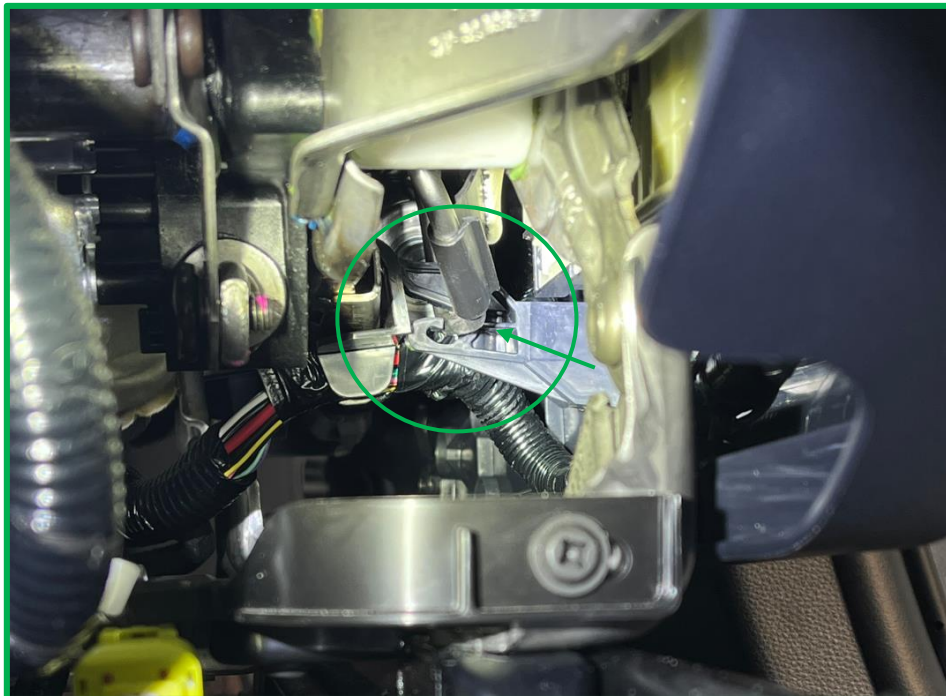


Figure 3: Lower attachment clip fully engaged in position.

Note: Inspection is made from the front looking under the seat point of view.

## LINK REFERENCES

1. [SEAT: FRONT SEAT ASSEMBLY \(for Manual Seat\): REASSEMBLY; 2022 - 2025 MY Tundra Tundra HV \[11/2021 - ???????\]](#)
2. [SEAT: FRONT SEAT ASSEMBLY \(for Power Seat\): REASSEMBLY; 2022 - 2024 MY Tundra Tundra HV \[05/2022 - 08/2024\]](#)