



# Service Bulletin

Bulletin No.: PIP6010B

Date: July, 2025

## PRELIMINARY INFORMATION

**Subject: Diagnostic Aids for VT40 Transmissions with DTC P0796**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Equinox	2025-2026		All	All	All	MRQ
GMC	Terrain	2025-2026		All	All	All	MRQ

<b>Involved Region or Country</b>	North America
<b>Condition</b>	Check Engine Light On.
<b>Cause</b>	DTC P0796 Setting.

### Correction

Some vehicles may experience a check engine light on.

This will generally occur with low mileage.

Upon investigation Technicians may find DTC P0796 Setting.

There may or may not be drivability symptoms with this DTC.

If this is found verify the fluid level following Document 4818020.

**Note:** The transmission fluid must be between 140 and 176 Degrees F to obtain an accurate reading.

If the fluid is low, add fluid to the transmission until it is at the proper level, clear the DTC'S and re-evaluate the vehicle.

If DTC P0796 resets following filling the transmission, or if the fluid level is not low and P0796 is setting please replace the valve body.

**Note:** The Solenoid valve body should not be replaced for this concern.

If the fluid level was low and the DTC does not reset following a test drive release the vehicle back to the customer.

**Parts Information**

Description	Part Number	Qty
Automatic Transmission Fluid HP CVTF	19355873	As Required

**Warranty Information**

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
* 8481118	Perform Transmission oil level check and set level	0.4 hrs.
*This is a unique Labor Operation for Bulletin use only.		

<b>Version</b>	3
<b>Modified</b>	09/27/2024 Created on. 05/20/2025 Updated to include Labor Operation and add Model. 07/10/2025 Updated to change Labor Operation and update model years.

