

REFERENCE:	TSB: 09-019-25 GROUP: 09 - Engine	Date:	July 16, 2025	REVISION:	–
VEHICLES AFFECTED:	2025 (WL) Jeep Grand Cherokee/ Grand Cherokee L This bulletin applies to the following vehicles built on or after June 02, 2025 (MDH 0602XX) and on or before June 05, 2025 (MDH 0605XX) equipped with the 3.6L V6 24V VVT UPG 1 W/ESS Engine (Sales Code ERC).	MARKET APPLICABILITY: <input checked="" type="checkbox"/> NA <input type="checkbox"/> MEA <input type="checkbox"/> SA <input type="checkbox"/> IAP <input type="checkbox"/> EE <input type="checkbox"/> CH NOTE: This bulletin applies to the North America market.			
CUSTOMER SYMPTOM:	Customers may experience the following: <ul style="list-style-type: none"> • A deterioration in engine performance. 				
CAUSE:	Disconnected Make Up Air Hose				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 25-134, date of issue July 16, 2025. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves inspecting the Make Up Air Hose and, if needed, reconnecting the hose to the resonator.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
09-20-20-95	Make Up Air Hose - Inspect Connection To Resonator (0 - Introduction)	1 - Engine Repair and Performance	0.2 Hrs.
09-20-20-96	Make Up Air Hose - Inspect And Connect (0 - Introduction)	1 - Engine Repair and Performance	0.2 Hrs.
Failure Code	ZY	Service Action	

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptom listed above in the customer symptom section, perform the Repair Procedure.

REPAIR PROCEDURE:

1. Open the hood.
2. Locate the air cleaner duct.
3. Follow the tubing along the left side of the engine.
4. Locate the Make Up Air hose quick connect with the gray tab.
5. Is the Make Up Air Hose disconnected [Fig. 1](#)?

**Fig. 1**

Make Up Air Hose Disconnected

- YES >>> Proceed to [Step 6](#).
 - NO >>> This bulletin does not apply. Use Inspect LOP (09-20-20-95) to close this active RSU. Perform further diagnostics.
6. Reconnect the Make Up Air Hose to the resonator [Fig. 2](#).

**Fig. 2**

Make Up Air Hose Connected

7. Employ a push - pull method to ensure a solid connection.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.