



GROUP	MODEL
ELE	2025MY Soul (SK3)
NUMBER	DATE
395	July 2025

## TECHNICAL SERVICE BULLETIN

### SERVICE ACTION: MDPS CONNECTOR LOCKING INSERT INSPECTION (SA623)

This bulletin provides information to inspect the steering MDPS connector on certain 2025MY Soul (SK3) vehicles produced on June 16, 2025, which may not have a fully engaged secondary lock on their MDPS connector, although the connector remains secured by the primary connector locking mechanism. Follow the procedure outlined in this publication to ensure that the yellow secondary locking insert is fully pushed in on the applicable vehicle. Before conducting the procedure, verify that the vehicle is included in the list of sixteen (16) affected VINs in dealer stock.

Affected VINs			
KNDJ23AU4S7958408	KNDJ23AU1S7958429	KNDJ23AU9S7958422	KNDJ23AU3S7958416
KNDJ23AU6S7958412	KNDJ23AU2S7958424	KNDJ23AUXS7958428	KNDJ23AU5S7958417
KNDJ23AU2S7958326	KNDJ23AU4S7958425	KNDJ23AUXS7958431	KNDJ23AU7S7958418
KNDJ23AU0S7958423	KNDJ23AU8S7958427	KNDJ23AU1S7958415	KNDJ23AU8S7958413

#### NOTICE

**A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.**

Repair status for a VIN is provided on KDealer+ (Service → Warranty Coverage → Warranty Coverage Inquiry → Campaign Information). Not completed Recall / Service Action reports are available on KDealer+ (Consumer Affairs → Not Completed Recall → Recall VIN → Select Report), which includes a list of affected vehicles.

This issue number is SA623.


**Inspection Procedure:**

- Under the driver steering wheel area, locate the MDPS wiring harness connector (A).

**TECH TIP**

Slide the driver seat backwards to allow for more workspace.


- Inspect the yellow secondary locking insert (B) of the MDPS wiring harness connector (A):

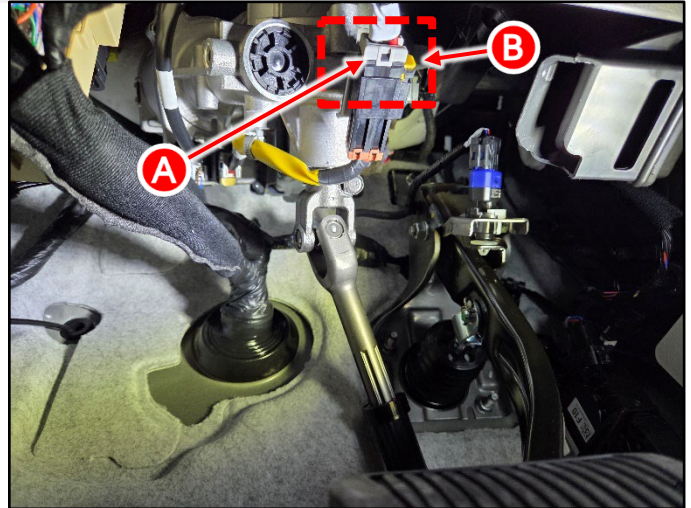

- The yellow secondary locking insert (B) is NOT fully inserted (seated flat) into the MDPS connector (**NG**). If so, simply press the yellow insert inward to complete this service action.

**IMPORTANT**


The MDPS wiring connector features a 'double locking' system.

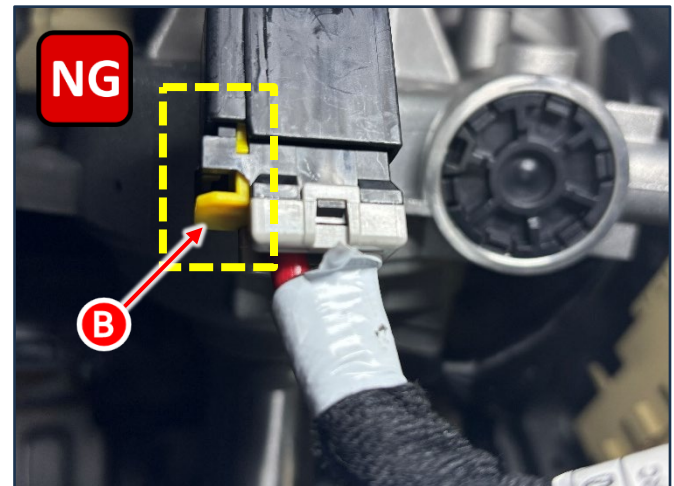

- The yellow secondary locking insert is fully inserted (seated flat) into the MDPS connector (**OK**). If so, no further action is required.

**NOTICE**

The MDPS wiring connector features a 'double locking' system. When inserting the MDPS wiring connector into the MDPS side, a 'primary' push-button lock/secures the connector in. The yellow secondary insert prevents the primary push-button from being pressed to release the MDPS wiring connector.

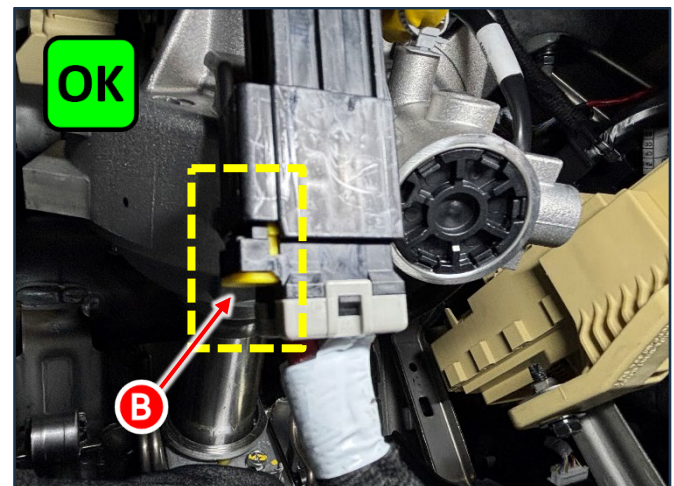

SUBJECT: SERVICE ACTION: MDPS CONNECTOR LOCKING INSERT INSPECTION (SA623)

**AFFECTED VEHICLE RANGE:**

Model	Production Date Range
Soul (SK3)	June 16, 2025

**WARRANTY INFORMATION:**

N Code: N99 C Code: C99

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
V	91271 K0061	0	(SA623) MDPS Connector Inspection	250140R0	0.2 M/H	N/A	0

**Note:** For Substitute Transportation policy, please refer to Service Policy and Procedures Manual (SPPM) 6.11 "Kia Substitute Transportation".

**NOTICE**

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference SA623 when accessing the KDealer+ system.

