


	GROUP	MODEL
	BOD	2024-2025MY EV9 (MV1)
	NUMBER	DATE
	341	July 2025
TECHNICAL SERVICE BULLETIN		
SUBJECT: CONSOLE ARMREST LOWER COVER AND BUMPER REPLACEMENT		

This bulletin provides information to replace the console armrest lower cover and bumpers on some 2024-2025MY EV9 (MV1) vehicles produced from July 27, 2023 through April 26, 2024. The affected vehicles may exhibit console armrest wobbling and/or rattling when closed. One or both bumpers can be missing, broken, and/or shifted out of place creating a gap between the console armrest and the console assembly which causes the console armrest to wobble and/or rattle while closed. To rectify this concern, follow the procedure outlined in this publication to replace the console armrest lower cover and bumpers on the applicable vehicle.

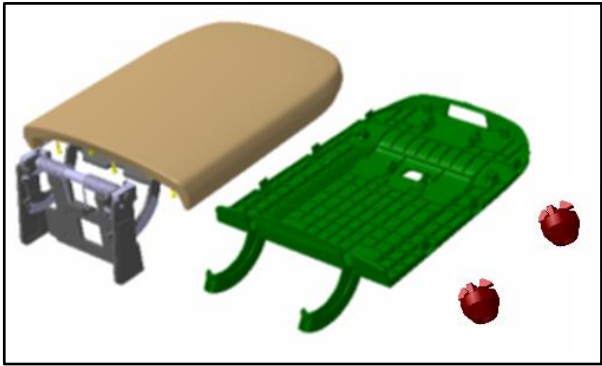


 NOTICE

A Technical Service Bulletin is a field fix repair program without customer notification that may be performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

A printed copy is for reference only; publication information can be updated at any time.
Always refer to KGIS for the latest information. After logging in kdealer.com, the newest technical publications are listed in 'Service Releases' and has the latest service information that has been released.

Repair Procedure:


1. Open the console armrest assembly (A).
2. Remove the console armrest assembly bumper(s) (B).

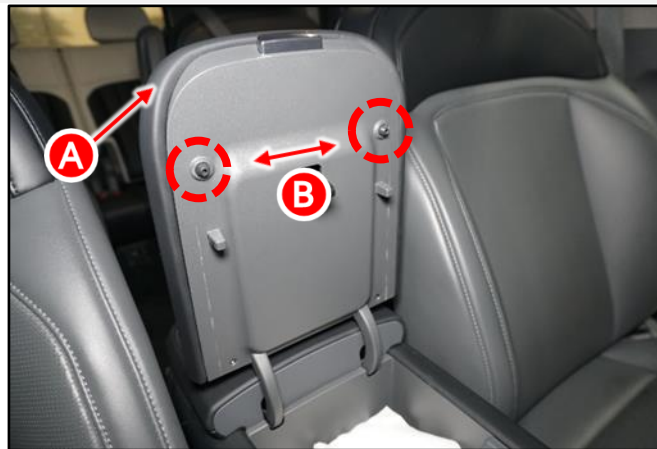

3. Loosen the five (5) retaining screws.




- 4a. Using a non-marring trim removal tool, separate the console armrest lower cover (C) from the console armrest assembly (A).

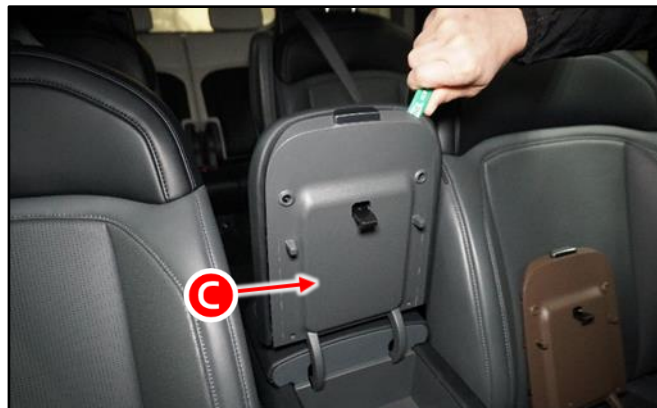

- 4b. Install the new console armrest lower cover (C).

5. Install the new console armrest assembly bumper(s) (B).

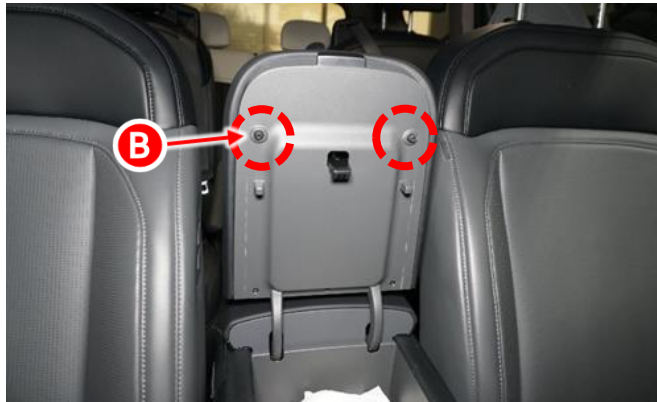

6. Confirm normal console armrest operation.

SUBJECT:

CONSOLE ARMREST LOWER COVER AND BUMPER REPLACEMENT**AFFECTED VEHICLE RANGE:**

Model	Production Date Range
EV9 (MV1)	July 27, 2023 to April 26, 2024

REQUIRED PART:

Part Name	Part Number	Figure	Qty.	Comments
Console Armrest Lower Cover	846X7 DO000DFSFF		1	Gray
	846X7 DO000CRNFF		1	Brown
Bumper	846B7 DO000FFF		1	Bumpers are Packaged in Quantities of 2

Note: The replacement part numbers will require a VIN entry for parts ordering. **DO NOT** order these parts for stocking purposes, related to this Campaign. Supply is very limited. Until the supply stabilizes, please confirm part availability before scheduling customers. Please be sure to expedite warranty claim filing.

WARRANTY INFORMATION:

N Code: Q57 C Code: ZZ3

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
W	84660 XA000EMA	0	Console Armrest Lower Cover and Bumper Replacement	846X7F01	0.3 M/H	846X7 DO000DFSFF or 846X7 DO000CRNFF	1
						846B7 DO000FFF	1

Note: For Substitute Transportation policy, please refer to Service Policy and Procedures Manual (SPPM) 6.11 "Kia Substitute Transportation".