

Nuisance Mirror Adjustment DTC:

Nuisance Mirror Adjustment DTC

Service Solution 785

Published: 06/24/2025

Problem Details:

Due to incorrect parametrization the door control module will set DTC 520272-5, when the vertical adjustment button is pressed for the raise or lower position.

The solution is to change parameters "Mirror Y-Axis" in both DCM02T and DCMP02T ECU's from enable to disable

FSPRs, FRACAS, DPR, Zeus:

- Found in the field
- Shopcall 577741

Affected Models / Truck options:

- 32 model year 2024-2025 47X, 49X, 57X vehicles

Responsible Supplier:

- DTNA



Production Containment:

☐ No ☒ Yes

- Issue found in the design chart, and it has now been updated correctly

Field Containment (short term):

- Change parameters to disable the DTC fault in the door control module

☒ No ☐ Yes

Root Cause:

- Engineering error with design chart

☐ No ☒ Yes

Long Term Corrective Action Plan:

- N/A design chart has been updated

☒ No ☐ Yes

Long Term Field Plan:

- Same as field containment

☐ No ☒ Yes