



SSM 54094 2025 Transit - Parking Aid Warning Message In The IPC - Parking Aid Sensor Part Numbers Listed Incorrectly In The Parts Catalog

Some 2025 Transit vehicles may exhibit a parking aid warning message in the instrument panel cluster (IPC) after parking aid sensor replacement. This may be due to parking aid sensor part numbers listed incorrectly in the parts catalog. For inner/outer parking aid sensors, use part number NU5Z-15K859-D. For side parking aid sensors, use part number NU5Z-15K859-E. The parts catalog will be updated to correct this. If the incorrect sensors are installed, the vehicle may set diagnostic trouble codes (DTCs) for an incorrect component.