

**WSE9 - Replace Disc Wheels (Workshop Campaign)**

Model Line: **911 (992)**

Model Year: **2025**

Equipment: Wheels painted in Anthracite Grey (**M-no. 1NA**)

Concerns: **Disc wheels**

Cause: **Disc wheels with different color or with different color hub caps were installed on the affected vehicles due to a control error.**

Action: Replace hub cap or disc wheels and hub cap depending on the assigned campaign scope.



**Information**

**Every vehicle is assigned to exactly one campaign scope.**

⇒ To determine the scope assigned to the relevant vehicle, see PCSS Vehicle Information.

Depending on the scope, the following actions ensue:

- **Scope 1:** Hand out disc wheels to the customer (customer consultation required)
- **Scope 2:** Replace disc wheels (customer consultation required)
- **Scope 3:** Replace wheel trim cover

Determine work procedure based on the scope assigned to the vehicle:

Assigned scope	Customer consultation	Action
Scope 1 and Scope 2	Customer wants the disc wheels already delivered with the vehicle to <b>remain installed</b> .	Hand out <b>new</b> disc wheels to the customer. <ul style="list-style-type: none"> <li>Enter the campaign in the Warranty and Maintenance Logbook.</li> <li>Invoicing: <b>Scope 1</b></li> </ul> <b>End of action.</b>
	Customer wants the <b>new</b> disc wheels to <b>be installed</b> .	Replace existing disc wheels with <b>new</b> disc wheels. Continue with: ⇒ <i>Technical Information 'Replace disc wheels with hub cap'</i>  Dismantled disc wheels can remain with the customer. <ul style="list-style-type: none"> <li>Invoicing: <b>Scope 2</b></li> </ul>
Scope 3	<b>Not necessary.</b>	Replace existing hub caps with <b>new</b> hub caps. <ul style="list-style-type: none"> <li>Enter the campaign in the Warranty and Maintenance Logbook.</li> <li>Invoicing: <b>Scope 3</b></li> </ul> <b>End of action.</b>

Affected  
Vehicles:

Only vehicles assigned to the campaign (see also PCSS Vehicle Information).

### Required parts

Parts Info: The **part numbers** of the **required parts** for the respective vehicle can be seen in the **assigned scope**. For an overview of the campaign scopes, see: ⇒ *Technical Information 'Warranty processing'*

For materials required for carrying out the action, see the corresponding Workshop Manual in PCSS. These lubricants are usually available in the Porsche Center.

For invoicing the necessary material for **Scope 2** during the warranty processing, enter **Part No. WSE90000001** with the "Consumables" designation as an **additional part** costing \$5.67 in the warranty claim.

## Required tools

- Tools:
- **P90999 - PIWIS Tester 4**
  - Battery charger with a current rating of **at least 90 A** and a **current and voltage-controlled charge map** for lithium starter batteries, e.g. **VAS 5908 - battery charger 90 A**. For further information about the battery chargers to be used, see the corresponding Workshop Manual. ⇒ *Workshop Manual '270689 Charge 12 Volt lithium-ion vehicle electrical system battery'*
  - Torque wrench, 40-200 Nm (30-148 ftlb.), e.g. **V.A.G 1332A - Torque wrench, 40-200 Nm (30-148 ftlb.)**

## Replace disc wheels with hub cap - only required for Scope 2



### Information

The disc wheels already delivered with the vehicle can remain with the customer.

- Work Procedure:
- 1 Remove wheels.  
⇒ *Workshop Manual '440519A1 Remove and install wheel'*
  - 2 Remove tires from existing disc wheels.  
⇒ *Workshop Manual '444019A3 Tyre mounting (remove and install tyres)'*
  - 3 Convert wheel electronics from existing disc wheels to **new** disc wheels.  
⇒ *Workshop Manual '443219A1 Remove and install wheel electronics'*
  - 4 Install tires on **new** disc wheels.  
⇒ *Workshop Manual '443219A1 Tyre mounting (remove and install tyres)'*
  - 5 Balance wheels.  
⇒ *Workshop Manual '440594 Balance wheels'*
  - 6 Install wheels.  
⇒ *Workshop Manual '440519A1 Remove and install wheel'*
  - 7 Teach wheel electronics.  
⇒ *Workshop Manual '443225A1 Teach wheel electronics'*
  - 8 Enter the campaign in the Warranty and Maintenance Logbook.

**Warranty processing****Information**

The specified labor times were determined specifically for carrying out this campaign and include all necessary preliminary and subsequent rework. The labor times can differ from the labor time published in the Labor Operation List in the PCSS.

Scope 1:

**Hand out disc wheels to the customer**

- Customer does **not** want to install the **new** disc wheels

<b>Labor time:</b>		
Hand out disc wheels to the customer		Labor time: <b>10 TU</b>
<b>Required parts:</b>		
V04015010Q	Alloy wheel – Front axle, anthracite	2 piece(s)
V04015010R	Alloy wheel – Rear axle, anthracite	2 piece(s)
9P1601147J TA0	Wheel trim cover – Alloy wheel, anthracite	4 piece(s)
WHT010187	Metal valve – Black	4 piece(s)
WHT010183	M5 x 12 internal hexagon round countersunk screw, self-locking – Valve	4 piece(s)
WHT010179	Union nut M11 x 0.75 – Black	4 piece(s)
WHT010180	Washer – Black	4 piece(s)
⇒ <b>Damage number WSE9 066 000 2</b>		

Scope 2:

**Replace disc wheels**

- Customer wants to install the **new** disc wheels
- Dismantled disc wheels can remain with the customer

**Labor time:**

Replace disc wheels

Labor time: **186 TU**

- Includes:
- Remove and install wheels
  - Install tires
  - Remove and install wheel electronics
  - Balance wheels

**Required parts:**

V04015010Q	Alloy wheel – Front axle, anthracite	2 piece(s)
V04015010R	Alloy wheel – Rear axle, anthracite	2 piece(s)
9P1601147J TA0	Wheel trim cover – Alloy wheel, anthracite	4 piece(s)
WHT010187	Metal valve – Black	4 piece(s)
WHT010183	M5 x 12 internal hexagon round countersunk screw, self-locking – Valve	4 piece(s)
WHT010179	Union nut M11 x 0.75 – Black	4 piece(s)
WHT010180	Washer – Black	4 piece(s)

**Required material:**

WSE90000001*	Consumables – Optimoly TA mounting paste – Adhesive weights (5 - 90 grams / 0.18 - 3.17 oz) – Tire mounting paste	1 piece(s) (for warranty invoicing only)
--------------	--	--

\*For invoicing the necessary material during the warranty processing, enter **Part No. WSE90000001** with the "Consumables" designation as an **additional part** costing \$5.67 in the warranty claim.

⇒ **Damage number WSE9 066 000 2**

Scope 3:

**Replace wheel trim cover**

- Vehicles with assigned scope 3 have disc wheels in the correct color installed, only the hub caps must be replaced due to wrong color

**Labor time:**

Replace wheel trim cover

Labor time: **19 TU****Required parts:**

9P1601147J TAO

Wheel trim cover  
– Alloy wheel, anthracite

4 piece(s)

⇒ **Damage number WSE9 066 000 2**

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2025 Porsche Cars North America, Inc.