

Technical Service Bulletin

Mazda North American Operations
Irvine, CA 92618-2922



Subject: POWER SEAT DOES NOT SLIDE FORWARD OR BACKWARD (6-WAY POWER SEAT ONLY)	Bulletin No.: 09-030/25
	Last Issued : 07/31/2025

BULLETIN NOTES

APPLICABLE MODEL(S)/VINS

2023-2025 CX-5 vehicles with VINs lower than JM3 KF**** ** 639884 (Produced before Jan., 2025)

Mexico Spec.:

2016-2022 CX-9 vehicles with VINs lower than JM3 TC**** ** 660048 (Produced before Mar., 2024)

NOTE: This service information applies to vehicles equipped with 6-Way Power Seat.

DESCRIPTION

The front seats on some vehicles (equipped with 6-way power seats) may not slide forward or backward when operating the power seat slide switch. This concern may be caused by a previous power seat switch shape modification where the strength was insufficient and caused the switch lever to break, resulting in inoperative seat operation. To eliminate this concern, the shape of the power seat switch has been returned to its previous shape.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify the customer concern.
2. Replace the power seat switch with a new one according to the instructions on MGSS:
 - CX-5: POWER SEAT SWITCH REMOVAL/INSTALLATION
 - CX-9: POWER SEAT SWITCH REMOVAL/INSTALLATION
3. Verify the repair.

PARTS INFORMATION

Parts Number	Description	Q'ty	Notes / Model
K157-88-158	SWITCH (L), POWER-SEAT	1	Left Side Seat - CX-5
****-88-***	SWITCH (L), POWER-SEAT	1	Left Side Seat - CX-9* (Mex

Page 1 of 2

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

	T		ico: Refer to GEPC)
KD1A-88-15X	SWITCH (R), POWER-SEA T	1	Right Side Seat - CX-5 / CX-9*
GRV1-88-166	KNOB (R), SLIDE	1	[R] CX-5 / CX-9*
KA0N-88-166 02	KNOB (R), SLIDE	1	[R] CX-5 / CX-9*
GRV1-88-1G5	KNOB (R), KNUCKLE	1	[R] CX-5 / CX-9*
KH26-88-1G5 02	KNOB (R), KNUCKLE	1	[R] CX-5 / CX-9*
TK48-88-1G5 02	KNOB (R), KNUCKLE	1	[R] CX-5 / CX-9*
KD45-88-585	CLIP	2	[R] CX-5 / CX-9*

[R]: Replacement parts

* CX-9 model is Mexico spec. only.

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	61
Damage Code	9A
Part Number Main Cause	K157-88-158 or KD1A-88-15X
Quantity	1
Operation No. and Labor Hours	XXX2HXRX / 0.4 Hrs.

NOTE: Claim the parts except "Part Number Main Cause" as related parts.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.