

Technical Service Bulletin

Topic	91 Audi connect Digital Key removal fails in the MMI
Market area	United States 444 Volkswagen of America, Inc. (6444)
Brand	Audi
Transaction No.	2078471/1
Level	EH
Status	Released for publishing
Release date	Jul 3, 2025

New customer code

Object of complaint	Complaint type	Position
information, navigation, communication, entertainment -> cell phone functions, customer portal, applications -> mobile terminal application (app)	control modules, services -> error message	
access control, start authorization, anti-theft protection -> locking/unlocking vehicle -> door release -> keyless entry door release	functionality -> no function	
engine -> engine operation -> engine start	functionality -> operation sequence incorrect	
access control, start authorization, anti-theft protection -> locking/unlocking vehicle -> door locking mechanism -> door locking with mobile device	functionality -> no function	
access control, start authorization, anti-theft protection -> locking/unlocking vehicle -> door release -> door unlocking with mobile device	functionality -> no function	
information, navigation, communication, entertainment -> Online Services -> registration process -> delete primary user	functionality -> no function	
engine -> engine operation -> engine start -> engine start with mobile device	functionality -> no function	
access control, start authorization, anti-theft protection -> locking/unlocking vehicle -> door locking mechanism -> keyless closing door locking mechanism	functionality -> partially out of order	
engine -> engine operation -> engine start -> engine start with key card	functionality -> no function	
information, navigation, communication, entertainment -> Online Services	functionality	
access control, start authorization, anti-theft protection -> locking/unlocking vehicle -> door release -> door unlocking with key card	functionality -> no function	
information, navigation, communication, entertainment -> Online Services -> registration process -> central locking/engine start mobile device registration	functionality -> no function	
access control, start authorization, anti-theft protection -> locking/unlocking vehicle -> door locking mechanism -> door locking with key card	functionality -> no function	
information, navigation, communication, entertainment -> Online Services -> registration process	functionality -> no function	

Vehicle data

Q6 e-tron

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
GH*	2025	A		*	*	*
GU*	2025	A		*	*	*
GF*	2025	A		*	*	*
FU*	2025	A		*	*	*

PR numbers

PR numbers
?:with 2F1

Documents

Document name
master.xml

Condition

Customer states:

Unable to delete a digital key in the vehicle or on the smartphone, even when the vehicle is online, has sufficient satellite reception and the ignition was not turned on using the digital key.

Workshop findings:

The customer statement can be reproduced.

Technical Background

Software issue in onboard supply control unit.

Production Solution

Not applicable

Service



This bulletin may apply to vehicles still within the new model launch repair authorization period!

- **For vehicles still in the launch phase, the workshop must create a case with the Technical Assistance Center (TAC) per the repair authorization. Reference this TSB in the first line of the TAC case.**

Make sure the vehicle is online and has a valid time signal (sufficient satellite reception).

Ensure the ignition was not activated using a digital key.

If these conditions have been met and the digital key still cannot be deleted, reset the 12V battery using a Terminal 30 reset for at least 10 minutes. Then ensure the same conditions are met again.

If the digital key still cannot be deleted, replace onboard supply control unit J519.

Warranty

For Terminal 30 reset:

Claim Type:

- If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.

Service Number:

9710

Damage Code:

0039

Labor Operations:	Loosen and secure earth strap	9785 0999	20 TU
	GFF / Guided Functions	0150 0060	Labor according to the diagnostic log
For Terminal 30 reset and replace onboard supply control unit:			
Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9710		
Damage Code:	0039		
Labor Operations:	Loosen and secure earth strap	9785 0950	See SRT with associated operations
	GFF / Guided Functions	0150 0060	Labor according to the diagnostic log
	Remove and install onboard supply control unit	9710 19xx	See SRT with associated operations
Claim Comment:	As per TSB 2078471/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2078471**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2025 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.