

High-Frequency Buzzing/Noises From Front Roof Console Area With Main Headlights Switched On (SY 15/25)

Model Line: **Macan (XAB)**

Model Year: **As of 2024**

Concerns: **Front roof console**

Symptom: **The customer complains about a high-frequency buzzing/noises from the area of the front roof console after switching on the main headlights.**

If you switch to the high beam headlight, turn off the main headlights or disconnect the front roof console, the noise is no longer detectable.

Cause: Voltage spikes in the vehicle electrical system can in rare cases cause high-frequency buzzing/noises in the front roof console.

Remedial Action: If a customer complaint exists, replace the existing front roof console with a front roof console with a new component status.

Required parts

Part Info:	Part No.	Designation – Location of use	Quantity
	Required parts for vehicles without roof insert (M-No. 3FA):		
	95C959551AFT-MO	⇒ Roof console – without E-Call & B-Call (M-No. IW0) or – with B-Call (M-No. IW2)	1 piece
	or		
	95C959551AGT-MO	⇒ Roof console – with E-Call (M-No. IW1) or – with E-Call & B-Call (M-No. IW3)	1 piece

Required parts for vehicles with Porsche large roof system (M-No. 3FU):

95C959551AHT- ⇒ Roof console 1 piece
MO – without E-Call & B-Call (**M-No. IW0**)

or– with B-Call (**M-No. IW2**)**or**

95C959551AJT- ⇒ Roof console 1 piece
MO – with E-Call (**M-No. IW1**)

or– with E-Call & B-Call (**M-No. IW3**)**Required tools**

- Tools:
- **P90999 - PIWIS Tester 4**
 - Battery charger with a current rating of **at least 90 A** and a **current and voltage-controlled charge map** for lithium starter batteries, e.g. **VAS 5908 - battery charger 90 A**. For further information about the battery chargers to be used, see the corresponding Workshop Manual. ⇒ *Workshop Manual '270689 Charge battery and vehicle electrical system'*
 - Plastic wedge, commercially available

Replace front roof console

- Work 1 Replace existing front roof console with front roof console with new component status.
Procedure: ⇒ *Workshop Manual '708355 Replace roof console'*

Labor position and PCSS encryption -

Labor position:

APOS	Labor operation	I No.
70835540	Remove and install front roof console	

PCSS encryption:

Location (FES5)	70830	Front roof console
Damage type (SA4)	2014	rattles

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2025 Porsche Cars North America, Inc.