



SSM 54101 2025 Ranger - Soft Brake Pedal Following Vehicle Start-Up With Various Brake System Illuminated Warning Lamps And/Or Brake-Related Messages Displayed In The IPC - DTC U3012:68 Stored In The ABS Module - Built On Or Before 18-June-2025

Some 2025 Ranger vehicles equipped with a 2.3/2.7L EcoBoost engine built on or before 12-June-2025 and 2025 Ranger Raptor vehicles equipped with a 3.0L EcoBoost engine built on or before 18-June-2025 may exhibit an illuminated anti-lock brake system (ABS) warning indicator with diagnostic trouble code (DTC) U3012:68 stored in the ABS module. The vehicle may also exhibit any of the following symptoms: a soft brake pedal following vehicle start-up, various brake system illuminated warning lamps and/or brake-related messages displayed in the instrument panel cluster (IPC). This may be due to a controller area network (CAN) communication concern within the ABS module. To correct this condition, reprogram the ABS module using the latest software level of the Ford Diagnosis and Repair System (FDRS). For claiming, use causal part 2005 and labor operations 2219D and 2219D44 in Section 02 of the Service Labor Time Standards (SLTS) Manual.