

<b>REFERENCE:</b>	<b>TSB:</b> 08-239-25 <b>GROUP:</b> 08 - Electrical	<b>Date:</b>	August 6, 2025	<b>REVISION:</b>	-
<b>VEHICLES AFFECTED:</b>	<b>2021 - 2025 (B1) Jeep Renegade</b> This bulletin applies to vehicles built on or after January 01, 2021 (MDH 0101XX) and on or before May 30, 2025 (MDH 0530XX) and equipped with Parkview Rear Back-Up Camera (Sales Code XAC).			<b>MARKET APPLICABILITY:</b> <input type="checkbox"/> NA <input type="checkbox"/> MEA <input checked="" type="checkbox"/> SA <input type="checkbox"/> IAP <input type="checkbox"/> EE <input type="checkbox"/> CH <b>NOTE:</b> This bulletin applies to the South America market.	
<b>CUSTOMER SYMPTOM:</b>	<b>Customers may experience the following:</b> <ul style="list-style-type: none"> <li>Rearview camera is inoperable, or shows a blue screen.</li> </ul>				
<b>CAUSE:</b>	<b>Manufacturing issue</b>				

**REPAIR SUMMARY:**

This bulletin involves replacing the rearview camera main harness.

**CLAIMS DATA:**

Labor Operation No:	Labor Description	Skill Category	Labor Time
08-90-75-9C	Rearview Camera Main Harness - Connector Inspect	6 - Electrical and Body Systems	0.5 Hrs.
08-90-75-9D	Rearview Camera Main Harness - Replace (1 - Semi-Skilled)	6 - Electrical and Body Systems	10.5 Hrs.
Failure Code	ZZ	Service Action	

**SPARE PARTS:**

Qty	Part No.	Description	Notes
1 (AR)	52245382 - EMEA 68755141AA - MOPAR	Wiring, Body	
1 (AR)	52248676 - EMEA 68755139AA - MOPAR	Wiring, Body	
1 (AR)	52257560 - EMEA 68755140AA - MOPAR	Wiring, Body	
1 (AR)	52257565 - EMEA 68755137AA - MOPAR	Wiring, Body	
1 (AR)	52248674 - EMEA 68755138AA - MOPAR	Wiring, Body	

**NOTE:** Reference the VIN to order the correct part.

**DIAGNOSIS:**

If the customer describes any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.

**REPAIR PROCEDURE:**

1. Remove the rear view camera. Refer to the detailed service procedures available in DealerCONNECT> Service Library under: Service Info> 5580H60 - Telecamera Traseira para Verificação de Obstáculos em Estacionamento - Remoção/Recolocação.
2. Check if the rear view camera connector [Fig. 1](#) (side main harness) is cracked or broken.



**Fig. 1**

Rear View Camera Connector

3. Was the rear view camera connector [Fig. 1](#) cracked or broken?
  - YES >>> Proceed to [Step 4](#).
  - NO >>> This bulletin has been completed. Use LOP (08-90-75-9C) to close the bulletin.

4. Replace the rear camera main harness. Refer to the detailed service procedures available in DealerCONNECT> Service Library under: Service Info> 5505C41 Chicote integrado no vao passageiros - Remocao/Recolocacao.

**NOTE: After applying this TSB, it is not necessary to send DID-I or DID-A.**

**POLICY:**

Reimbursable within the provisions of the warranty.

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*