

MAS004847 RU 25-23

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



Maserati

PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 802 GranTurismo – Cooling Fan Terminal Inspection



DATE: August 7 2025

This bulletin provides instructions for inspecting the cooling fan terminal positioning on certain Maserati GranTurismo and GranCabrio vehicles. In some cases, the terminal's orientation may require adjustment to ensure optimal clearance and routing. Performing this check helps support reliable cooling system operation and avoids potential contact with nearby components.

The update consists of a visual inspection and, when applicable, repositioning of the terminal.

VEHICLES INVOLVED: GranTurismo (M189), GranCabrio (M190) MY24 MY25

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.

Maserati North America
Aftersales Dept.

Technical Procedure

 All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. **Access the Junction Node Box**
 - Open the engine hood.
 - Locate the junction node box mounted on the **right front shock tower (RHT dome)**.


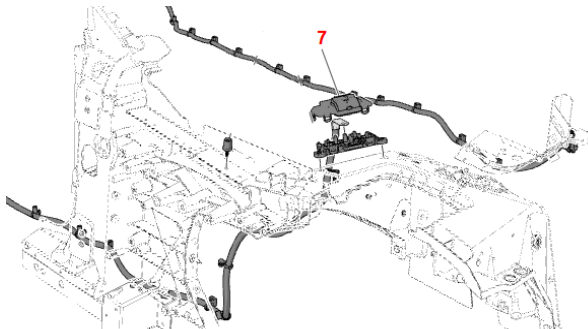


Figure 1: Position of the junction node box in the vehicle.



3. Inspect Terminal Orientation

- **Correct Configuration:** Terminal wiring is routed cleanly, seated properly, and clear of adjacent components. No further action is needed. Release the vehicle (**Figure 1**).
- **Adjustment Needed:** Terminal appears to be flipped (**Figure 2**) or in contact with surrounding components.

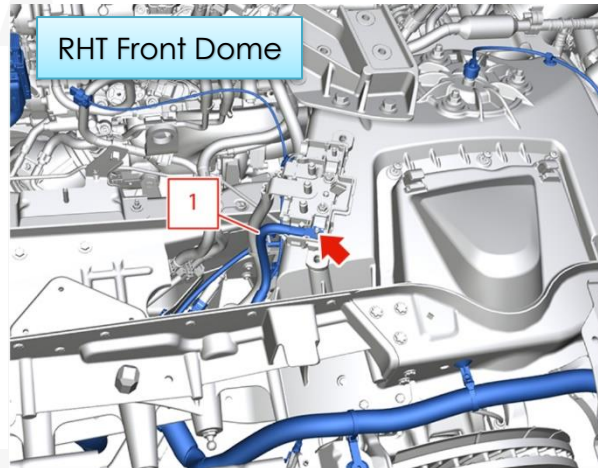

4. If Adjustment is Needed:

- Disconnect the battery following TechDocs procedure (8.20.001).
- Remove the retaining nut.
- Flip the terminal over so that it is seated properly as per **Figure 1**.
- Install a new nut and torque to specification.
- Reinstall all other components as needed.

5. Final Verification

- Ensure secure fitment and routing, double check fan operation.
- Proceed with vehicle release.

Parts Information

Description	Part number	Amount
M5 NUT	675001427	1

Warranty Claim Information

Please complete the warranty request as follows:

Description	Code
Rapid Update Number	802
Warranty code	23
Error code	063
Component Code	8.20.119
Operation Code	
▪ Check	8.20.119.A (0.05 h)
▪ Rework	8.20.119.B (0.10 h)